

---

Proposed Subdivision  
Billy's Lookout –  
Stages 16 & 17  
Site Classification

---

Outrigger Drive, Teralba

---

NEW15P-0070F-AE  
11 July 2023

---



11 July 2023

McCloy Development Management Pty Ltd  
Suite 2, Ground Floor, 317 Hunter Street  
NEWCASTLE NSW 2300

**Attention: Mr Harry Thomson**

Dear Sir


**RE: RESIDENTIAL SUBDIVISION – BILLY'S LOOKOUT – STAGES 16 & 17  
OUTRIGGER DRIVE, TERALBA  
SITE CLASSIFICATION (LOTS 1601 TO 1617 AND 1701 TO 1706)**

Please find enclosed our geotechnical report for Stages 16 and 17 of the 'Billy's Lookout' residential subdivision, located at Outrigger Drive, Teralba.

The report provides site classification with respect to reactive soils, in accordance with the requirements of AS2870-2011 '*Residential Slabs and Footings*', for Stage 16 (Lots 1601 to 1617) and Stage 17 (Lots 1701 to 1706).

If you have any questions regarding this report, please do not hesitate to contact Ben Edwards, Shannon Kelly, or the undersigned.

For and on behalf of Qualtest Laboratory (NSW) Pty Ltd

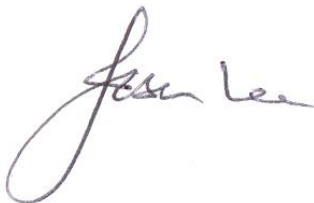

Jason Lee  
Principal Geotechnical Engineer

## Table of Contents:

1.0	Introduction .....	1
2.0	Desktop Study .....	1
3.0	Field Work .....	1
4.0	Site Description .....	2
4.1	Site Regrade Works.....	2
4.2	Surface Conditions .....	3
4.3	Subsurface Conditions.....	5
5.0	Laboratory Testing .....	8
6.0	Site Classification to AS2870-2011 .....	9
7.0	Limitations.....	11

## Attachments:

Figure AE1:	Site Plan and Approximate Test Locations (Stage 16)
Figure AE2:	Site Plan and Approximate Test Locations (Stage 17)
Appendix A:	Results of Field Investigations
Appendix B:	Results of Laboratory Testing
Appendix C:	CSIRO Sheet BTF 18

## 1.0 Introduction

Qualtest Laboratory NSW Pty Ltd (Qualtest) is pleased to present this geotechnical site classification report on behalf of McCloy Development Management Pty Ltd (McCloy), for Stages 16 and 17 of the 'Billy's Lookout' residential subdivision, located at Outrigger Drive, Teralba.

Based on the brief and drawing provided by the client, Stage 16 is understood to comprise of 17 residential allotments (Lots 1601 to 1617), and Stage 17 is understood to comprise of six allotments (Lots 1701 to 1706).

The scope of work for the geotechnical investigation included site classification with respect to reactive soils, in accordance with the requirements of AS2870-2011 '*Residential Slabs and Footings*', for Stages 16 and 17, following completion of site regrade works.

This report presents the results of the field work investigations and laboratory testing, and provides recommendations for the scope outlined above.

## 2.0 Desktop Study

The scope of work has included a review of the following reports completed by Qualtest or others, as noted below:

- Level 1 Site Re-grade Assessment Report, 'Billy's Lookout Subdivision – Stage 16, 17 & 24, Teralba, (Qualtest Report Reference: NEW22P-0067-AA, dated 13 June 2023); and,
- Geotechnical Assessment report by Qualtest, 'Proposed Subdivision, Billy's Lookout - Stages 10, 16 & 17, Outrigger Drive, Teralba, (Report Reference: NEW15P-0070F-AA, dated 22 November 2019).

This report includes a summary of selected results from the previous reports where applicable.

## 3.0 Field Work

Field work investigations were carried out on 14 June 2023 and comprised of:

- DBYD search and visual check of proposed test locations for the presence of underground services;
- Site walkover to make observations of surface features at the property and in the immediate surrounding area;
- Drilling 16 boreholes (BH1601 to BH1611 and BH1701 to 1705) using a 2.7 tonne excavator equipped with a 300mm diameter auger attachment. Boreholes were terminated at depths of between 0.50m and 2.10m;
- Undisturbed samples (U50 tubes) and small bag samples were taken for subsequent laboratory testing; and,
- Boreholes were backfilled with the excavation spoil and compacted using the excavator auger and tracks.

Investigations were carried out by an experienced Geotechnical Engineer from Qualtest who located the boreholes, carried out the testing and sampling, produced field logs of the boreholes, and made observations of the site surface conditions.

Engineering logs of the boreholes are presented in Appendix A.

Approximate borehole locations are shown on the attached Figures AE1 and AE2. Boreholes were located in the field by handheld GPS and relative to existing site features.

## 4.0 Site Description

### 4.1 Site Regrade Works

Following an initial site visit, stripping assessments and recommendations performed on 12 April 2022 (Qualtest Site Record Form ref. NEW22P-0067-S01, dated 20/04/22, and multiple subsequent visits throughout the project), site re-grading works within Stages 16 and 17 were conducted between 19 April 2022 and 2 February 2023.

Re-grade works included filling within all or portions of residential lots 1601 to 1617, and 1701 to 1706, along with filling works for proposed noise walls, retaining walls and infrastructure works for access to the Teralba Train Station.

Prior to filling, re-grade areas were stripped of topsoil and unsuitable material to expose the suitable natural foundation profile. Preparation works were then performed, which consisted of tining, re-conditioning and re-compaction of the stripped surface, prior to filling with approved site fill to design finish levels.

Filling was generally performed using site material won from excavations within the cut areas of the development. The fill material could generally be described as mixtures of Residual (CI-CH) Sandy CLAY, medium to high plasticity, brown / red / grey in colour, with fine to coarse grained Sand and Gravel, along with Extremely Weathered (EW) Conglomerate / Sandstone, pale yellow / brown in colour, blended with minor quantities of on-site pale brown Colluvium.

The approximate depth of fill placed ranged in the order of 0.1m to about 4.5m, with the deepest areas associated with the access to the Teralba Train Station, adjacent to the noise wall and existing rail corridor.

The approximate range of fill placed within each stage (excluding topsoil), was in the order of:

#### **Stage 16**

- Lots 1601 to 1602 – 0.5m to 1.5m;
- Lot 1603 – 0.5m to 3.0m;
- Lots 1604 to 1607 – 0.5m to 2.0m;
- Lots 1608 to 1612 – 0.0m to 0.6m;
- Lots 1613 to 1617 – 0.0m to 0.3m;
- Access to the Teralba Train Station – 0.1m to 4.5m.

#### **Stage 17**

- Lots 1701 to 1703 – 0.3m to 1.5m;
- Lots 1704 to 1706 – 0.0m to 0.6m.

The fill was compacted in maximum lifts of 0.3m thickness. Any unsuitable or deleterious material within the fill was removed by hand or mechanical means prior to final compaction of the material.

As the geotechnical testing authority engaged for the project, Qualtest state that the filling performed for the re-grade areas within Stages 16 and 17 (as detailed in the site regrade report), was carried out to Level 1 criteria as defined in Clause 8.2 – Section 8 of AS3798-2007, "Guidelines on Earthworks for Commercial and Residential Developments".

Refer to Qualtest Level 1 Site Re-grade Assessment Report (Ref. NEW22P-0067-AA, dated 13 June 2023) for further details including the approximate limit of filling works for this stage of the project.

The recommendations of this report are based on the understanding that any existing lot re-grade works are limited to the controlled earthworks supervised by Qualtest, placement of the fill material observed to depths of 0.4m or less within test pits, and placement of low reactivity topsoil material such that total depth of topsoil and uncontrolled fill does not exceed 0.4m. Qualtest should be informed without delay if additional earthworks are known to have been carried out.

## 4.2 Surface Conditions

The site comprises proposed Stages 16 & 17 of the Billy's Lookout subdivision, located off Outrigger Drive, Teralba, as shown on Figures AE1 & AE2.

It is located in a region of gently to moderately undulating topography, on the upper to mid slopes of a broad hill formation.

The site is bounded to the east by existing Stage 24 and the Main Northern Railway, to the north by Outrigger Drive and existing bushland, to the west by Stage 17 and existing cemetery, and future stages of the subdivision development to the south.

On the day of the field investigations, the site had been cleared, associated retaining walls had been constructed, and topsoil had been placed in most areas of the lots.

The majority of the site was judged to be moderately drained by way of surface runoff and inter-allotment drainage, typically towards the north and northeast.

Trafficability was judged to be good by way of 4WD vehicle along the existing pavement at the front of the lots.

Selected photographs of the site taken on the day of the site investigations are shown below.



**Photograph 1:** From Lot 1606, (near BH1601), facing west.



**Photograph 2:** From Lot 1606, (near BH1601), facing north.



**Photograph 3:** From Lot 1607, (near BH1601), facing northeast. Showing Outrigger Drive in background.



**Photograph 4:** From Lot 1607, (near BH1601), facing southeast.



**Photograph 5:** From Lot 1612, (near BH1606), facing east.



**Photograph 6:** From Lot 1612, (near BH1606), facing southeast.



**Photograph 7:** From Lot 1702, (near BH1701), facing northwest.



**Photograph 8:** From Lot 1702, (near BH1701), facing northeast.



**Photograph 9:** From Lot 1705, (near BH1704), facing northwest.



**Photograph 10:** From Lot 1706, (near BH1705), facing northeast.



**Photograph 11:** From Lot 1615, (near BH1609), facing north.



**Photograph 12:** From Lot 1615, (near BH1609), facing northeast.

### 4.3 Subsurface Conditions

Reference to the 1:100,000 Newcastle Coalfield Regional Geology Sheet indicates the site to be underlain by the Moon Island Beach Subgroup of the Newcastle Coal Measures, which is characterised by Conglomerate, Sandstone, Siltstone, Claystone, Tuff and Coal rock types.

Table 1 presents a summary of the typical soil types encountered on site during the field investigations, divided into representative geotechnical units.

Table 2 contains a summary of the distribution of the above geotechnical units at the borehole locations.



**TABLE 1 – SUMMARY OF GEOTECHNICAL UNITS AND SOIL TYPES**

Unit	Soil Type	Description
1A	FILL – TOPSOIL	Sandy CLAY, Sandy CLAY / Clayey SAND – low to medium plasticity, dark grey to brown, fine to coarse grained sand, with some fine to medium grained sub-rounded to sub-angular gravel.
1B	FILL - Controlled	Sandy CLAY, CLAY, Sandy Gravelly CLAY – generally medium plasticity, pale orange-brown, fine to coarse grained sand, with some fine to coarse grained sub-rounded gravel.  Clayey Gravelly SAND / Sandy CLAY– fine to medium grained, grey to brown, fine to coarse grained rounded to sub-angular gravel, fines of low plasticity.  Clayey Sandy GRAVEL – fine to coarse grained, rounded to sub-rounded, pale orange-brown, fine to coarse grained sand, fines of low to medium plasticity.
2	TOPSOIL	Not Encountered within current investigation.
3	SLOPEWASH / COLLUVIUM	Not Encountered within current investigation.
4	RESIDUAL SOIL	Sandy CLAY, CLAY – medium to high plasticity, grey to pale brown with orange, fine to medium / coarse grained sand, trace fine to medium grained rounded to sub-rounded gravel.  Gravelly Sandy CLAY - medium plasticity, pale brown to grey, fine to coarse grained sand, fine to coarse grained rounded to sub-rounded gravel.  Clayey Gravelly SAND – fine to medium grained, orange to pale brown, trace pale grey, fine to medium grained rounded to sub-rounded gravel, fines of low to medium plasticity.  Clayey Sandy GRAVEL – fine to coarse grained, rounded to sub-rounded, orange-brown, trace pale grey, fines of medium plasticity, fine to coarse grained sand.
5	EXTREMELY WEATHERED (XW) ROCK with soil properties	Sandstone; breaks down into Clayey SAND / Gravelly SAND – fine to medium grained, orange-brown, trace pale grey, fines of low plasticity, fine to coarse grained rounded to sub-rounded gravel.  Pebbly Sandstone; breaks down into Sandy GRAVEL, Sandy Gravelly CLAY – fine to coarse grained, rounded to sub-rounded, pale grey and pale brown, fine to coarse grained sand, trace fines of low plasticity.
6	HIGHLY WEATHERED (HW) ROCK	SANDSTONE – fine to medium grained, orange to pale brown with grey, estimated very low to low strength.  Pebbly SANDSTONE, CONGLOMERATE – fine to medium grained matrix, grey with orange to pale orange, fine to medium grained rounded clasts, estimated low to medium strength.  Generally grading to medium strength (or better) with depth.

**TABLE 2 – SUMMARY OF GEOTECHNICAL UNITS ENCOUNTERED AT BOREHOLE LOCATIONS**

Location	UNIT 1A Fill - Topsoil	UNIT 1B Fill - Controlled	UNIT 2 Topsoil	Unit 4 Residual Soil	Unit 5 XW Rock	Unit 6 HW Rock
	Depth (m)					
BH1601	0.00 - 0.15	0.15 - 1.90	-	1.90 - 2.00	-	-
BH1602	0.00 - 0.25	0.25 - 0.30	-	-	0.30 - 0.60	0.60 - 1.50*
BH1603	0.00 - 0.10	0.10 - 1.30	-	1.30 - 2.00	-	-
BH1604	0.00 - 0.10	0.10 - 1.90	-	1.90 - 2.10	-	-
BH1605	0.00 - 0.20	-	-	0.20 - 1.20	1.20 - 1.70	1.70 - 2.00*
BH1606	0.00 - 0.20	-	-	0.20 - 1.40	1.40 - 2.00^	-
BH1607	0.00 - 0.20	0.20 - 1.00	-	-	1.00 - 1.20	1.20 - 1.40*
BH1608	0.00 - 0.25	-	-	-	0.25 - 0.45	0.45 - 0.50*
BH1609	0.00 - 0.15	-	-	-	0.15 - 0.50	0.50 - 0.55*
BH1610	0.00 - 0.30	-	-	-	0.30 - 0.60	0.60 - 1.00*
BH1611	0.00 - 0.20	-	-	-	0.20 - 0.50	0.50 - 0.80*
BH1701	0.00 - 0.20	0.20 - 1.50	-	-	-	1.50 - 1.90*
BH1702	0.00 - 0.25	0.25 - 1.80	-	-	-	1.80 - 1.82*
BH1703	0.00 - 0.25	0.25 - 1.20	-	1.40 - 1.60	1.20 - 1.40 1.60 - 1.70	1.70 - 1.72*
BH1704	0.00 - 0.25	0.25 - 1.10	-	-	1.10 - 1.40	1.40 - 1.42*
BH1705	0.00 - 0.20	-	-	-	0.20 - 0.70	0.70 - 1.20*
<b>Previous investigation (Ref. NEW15P-0070F-AA, dated 22/11/2019)</b>						
TPP01	-	-	0.00 - 0.15	0.15 - 0.60	0.60 - 0.80	0.80 - 0.85*
TPP02	0.00 - 0.10	-	-	0.10 - 0.60	-	0.60 - 0.65*
TPP03	-	-	0.00 - 0.30	0.30 - 1.00	-	1.00 - 1.05*
TPP08	-	-	0.00 - 0.40	-	0.40 - 0.70	0.70 - 0.75*
TPP09	-	-	0.00 - 0.15	0.15 - 0.90	0.90 - 1.85^	-
TPP10	-	-	0.00 - 0.20	0.20 - 0.80	0.80 - 1.10	1.10 - 1.20^
<b>Notes:</b>	* = Refusal or Practical refusal of 2.7 tonne excavator on Highly Weathered Rock. ^ = Slow to very slow progress, close to practical refusal.					

No groundwater was encountered in the boreholes or test pits during the limited time that they remained open on the day of the field investigation.

It should be noted that groundwater conditions can vary due to rainfall and other influences including regional groundwater flow, temperature, permeability, recharge areas, surface condition, and subsoil drainage.

## 5.0 Laboratory Testing

Samples collected during the field investigations were returned to our NATA accredited Newcastle Laboratory for testing which comprised of:

- (4 no.) Shrink / Swell tests; and,
- (9 no.) Atterberg Limits tests.

Proposed shrink/swell testing for a number of samples were replaced by Atterberg Limits classification tests due to the friable nature of the site soils.

Results of the laboratory testing are presented in Appendix B, with a summary of the test results presented in Table 3 and Table 4.

The tables also include a summary of laboratory testing information where applicable from the previous Geotechnical Assessment carried out by Qualitest.

**TABLE 3 – SUMMARY OF SHRINK/SWELL TESTING RESULTS**

Location	Depth (m)	Material Description	I <sub>ss</sub> (%)
<b>Current Investigation</b>			
BH1601	0.50 - 0.62	FILL: (Cl) Sandy CLAY	0.6
BH1701	0.60 - 0.84	FILL: (Cl) Gravelly Sandy CLAY	0.4
BH1702	0.50 - 0.64	(Cl) Sandy CLAY	0.7
BH1704	0.40 - 0.55	(Cl) Gravelly Sandy CLAY	0.5
<b>Previous investigation (Ref. NEW15P-0070F-AA, dated 22/11/2019)</b>			
TPP03	0.45 - 0.65	(CH) Sandy CLAY	2.9
TPP10	0.25 - 0.55	(Cl) Sandy CLAY	1.8

**TABLE 4 – SUMMARY OF ATTERBERG LIMITS TESTING RESULTS**

Location	Depth (m)	Material Description	Liquid Limit (%)	Plasticity Index (%)	Linear Shrinkage (%)
<b>Current Investigation</b>					
BH1603	0.50 – 0.70	FILL: (SC) Gravelly Clayey SAND	33	14	5.0
BH1603	1.30 – 1.50	(CH) CLAY	39	15	6.0
BH1604	0.50 – 0.70	FILL: (SC) Gravelly Clayey SAND	37	19	4.0
BH1604	1.90 – 2.00	(CH) CLAY	43	20	6.5
BH1605	0.80 – 0.94	(CL) Sandy Gravelly CLAY	36	12	4.0
BH1606	0.50 – 0.70	(SC) Clayey Gravelly SAND	36	12	6.5
BH1607	0.50 – 0.75	FILL: (CI) Sandy Gravelly CLAY	39	26	4.5
BH1610	0.15 – 0.30	FILL – Topsoil: (CL) Sandy CLAY	32	16	3.5
BH1703	0.80 – 1.00	(CI) Gravelly Sandy CLAY	30	12	3.5
<b>Previous investigation (Ref. NEW15P-0070F-AA, dated 22/11/2019)</b>					
TPP01	0.40 - 0.60	(CH) Sandy CLAY	73	47	10.5

## 6.0 Site Classification to AS2870-2011

Based on the results of the field work and laboratory testing carried out, proposed residential lots located within Billy’s Lookout Stages 16 and 17 at Outrigger Drive, Teralba, as shown on Figures AE1 and AE2, are classified in their current condition in accordance with AS2870-2011 ‘Residential Slabs and Footings’, as shown in Table 5.

**TABLE 5 – SITE CLASSIFICATION TO AS2870-2011**

Stage No.	Lot Numbers	Site Classification
16	1609, 1613 to 1617	<b>M</b>
	1601 to 1608, 1610 to 1612	<b>H1</b>
17	1706	<b>M</b>
	1701 to 1705	<b>H1</b>

A characteristic free surface movement of 20mm to 40mm is estimated for lots classified as **Class ‘M’** in their existing condition.

A characteristic free surface movement of 40mm to 60mm is estimated for lots classified as **Class ‘H1’** in their existing condition.

The effects of changes to the soil profile by additional cutting and filling and the effects of past and future trees should be considered in selection of the design value for differential movement.

If site re-grading works involving cutting or filling are performed after the date of this assessment, the classification may change and further advice should be sought.

Final site classification will be dependent on a number of factors, including depth of topsoil, depth of fill and residual soil, reactivity of the natural soil and any fill material placed, and the level of supervision carried out. Re-classification of lots should be confirmed by the geotechnical authority at the time of construction following any site re-grade works.

Footings for the proposed development should be designed and constructed in accordance with the requirements of AS2870-2011.

The classification presented above assumes that:

- All footings are founded in controlled fill (if applicable) or in the residual clayey soils or rock below all non-controlled fill, topsoil material and root zones, and fill under slab panels meets the requirements of AS2870-2011, in particular, the root zone must be removed prior to the placement of fill materials beneath slabs.
- The performance expectations set out in Appendix B of AS2870-2011 are acceptable, and that site foundation maintenance is undertaken to avoid extremes of wetting and drying.
- Footings are to be founded outside of or below all zones of influence resulting from existing or future service trenches.
- The constructional and architectural requirements for reactive clay sites set out in AS2870-2011 are followed.
- Adherence to the detailing requirement outlined in Section 5 of AS2870-2011 '*Residential Slabs and Footings*' is essential, in particular Section 5.6, '*Additional requirements for Classes M, H1, H2 and E sites*' including architectural restrictions, plumbing and drainage requirements.
- Site maintenance complies with the provisions of CSIRO Sheet BTF 18, "*Foundation Maintenance and Footing Performance: A Homeowner's Guide*", a copy of which is attached in Appendix C.

All structural elements on all lots should be supported on footings founded beneath all uncontrolled fill, layers of inadequate bearing capacity, soft/loose, wet or other potentially deleterious material.

If any localised areas of uncontrolled fill of depths greater than 0.4m are encountered during construction, footings should be designed in accordance with engineering principles for Class 'P' sites.

## 7.0 Limitations

This report comprises the results of an investigation carried out for a specific purpose and client as defined in the document. The report should not be used by other parties or for purposes or projects other than those assumed and stated within the report, as it may not contain adequate or appropriate information for applications other than those assumed or advised at the time of its preparation. The contents of the report are for the sole use of the client and no responsibility or liability will be accepted to any third party. The report should not be reproduced either in part or in full, without the express permission of Qualtest.

Geotechnical site investigation is based on data collection, judgment, experience, and opinion. By its nature, it is less exact than other engineering disciplines. The findings presented in the report and used as the basis for recommendations presented herein were obtained using normal, industry accepted geotechnical design practices and standards. To our knowledge, they represent a reasonable interpretation of the general conditions of the site. Under no circumstances, however, can it be considered that these findings represent the actual state of the site at all points.

The recommended depth and properties of any soil, rock, groundwater, or other material referred to in this report is an engineering estimate based on the information available at the time of its writing. The estimate is influenced and limited by the fieldwork method and testing carried out in the site investigation, and other relevant information as has been made available. In cases where information has been provided to Qualtest for the purposes of preparing this report, it has been assumed that the information is accurate and appropriate for such use. No responsibility is accepted by Qualtest for inaccuracies within any data supplied by others.

The extent of testing associated with this assessment is limited to discrete test locations. It should be noted that subsurface conditions between and away from the test locations may be different to those observed during the field work and used as the basis of the recommendations contained in this report.

If site conditions encountered during construction differ from those given in this report, further advice should be sought without delay.

This report alone should not be used by contractors as the basis for preparation of tender documents or project estimates. Contractors using this report as a basis for preparation of tender documents should avail themselves of all relevant background information regarding the site before deciding on selection of construction materials and equipment.

If you have any further questions regarding this report, please do not hesitate to contact Ben Edwards, Shannon Kelly, or the undersigned.

For and on behalf of Qualtest Laboratory (NSW) Pty Ltd.



Jason Lee  
Principal Geotechnical Engineer

**FIGURE AE1:**

**Site Plan and Approximate Test Locations  
(Stage 16)**

**FIGURE AE2:**

**Site Plan and Approximate Test Locations  
(Stage 17)**




# SALE PLAN FOR BILLY'S LOOKOUT STAGE 16



--- PROPOSED SEWER LINE

- (AA) - EASEMENT TO DRAIN WATER 2 WIDE
- (AB) - RESTRICTION ON THE USE OF LAND 0.7 WIDE
- (AC) - EASEMENT FOR SIGNAGE 3 WIDE
- (AD) - EASEMENT FOR CONSTRUCTION & MAINTNENANCE 0.7 WIDE

(GENERAL RESTRICTIONS ON THE USE OF LAND EFFECTS ALL LOTS. ALL AREAS, DIMENSIONS & EASEMENTS ARE SUBJECT TO FINAL SURVEY)

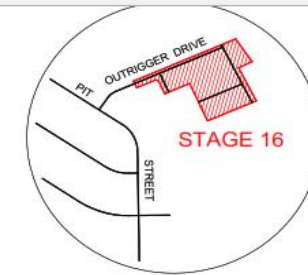

### LOCALITY PLAN

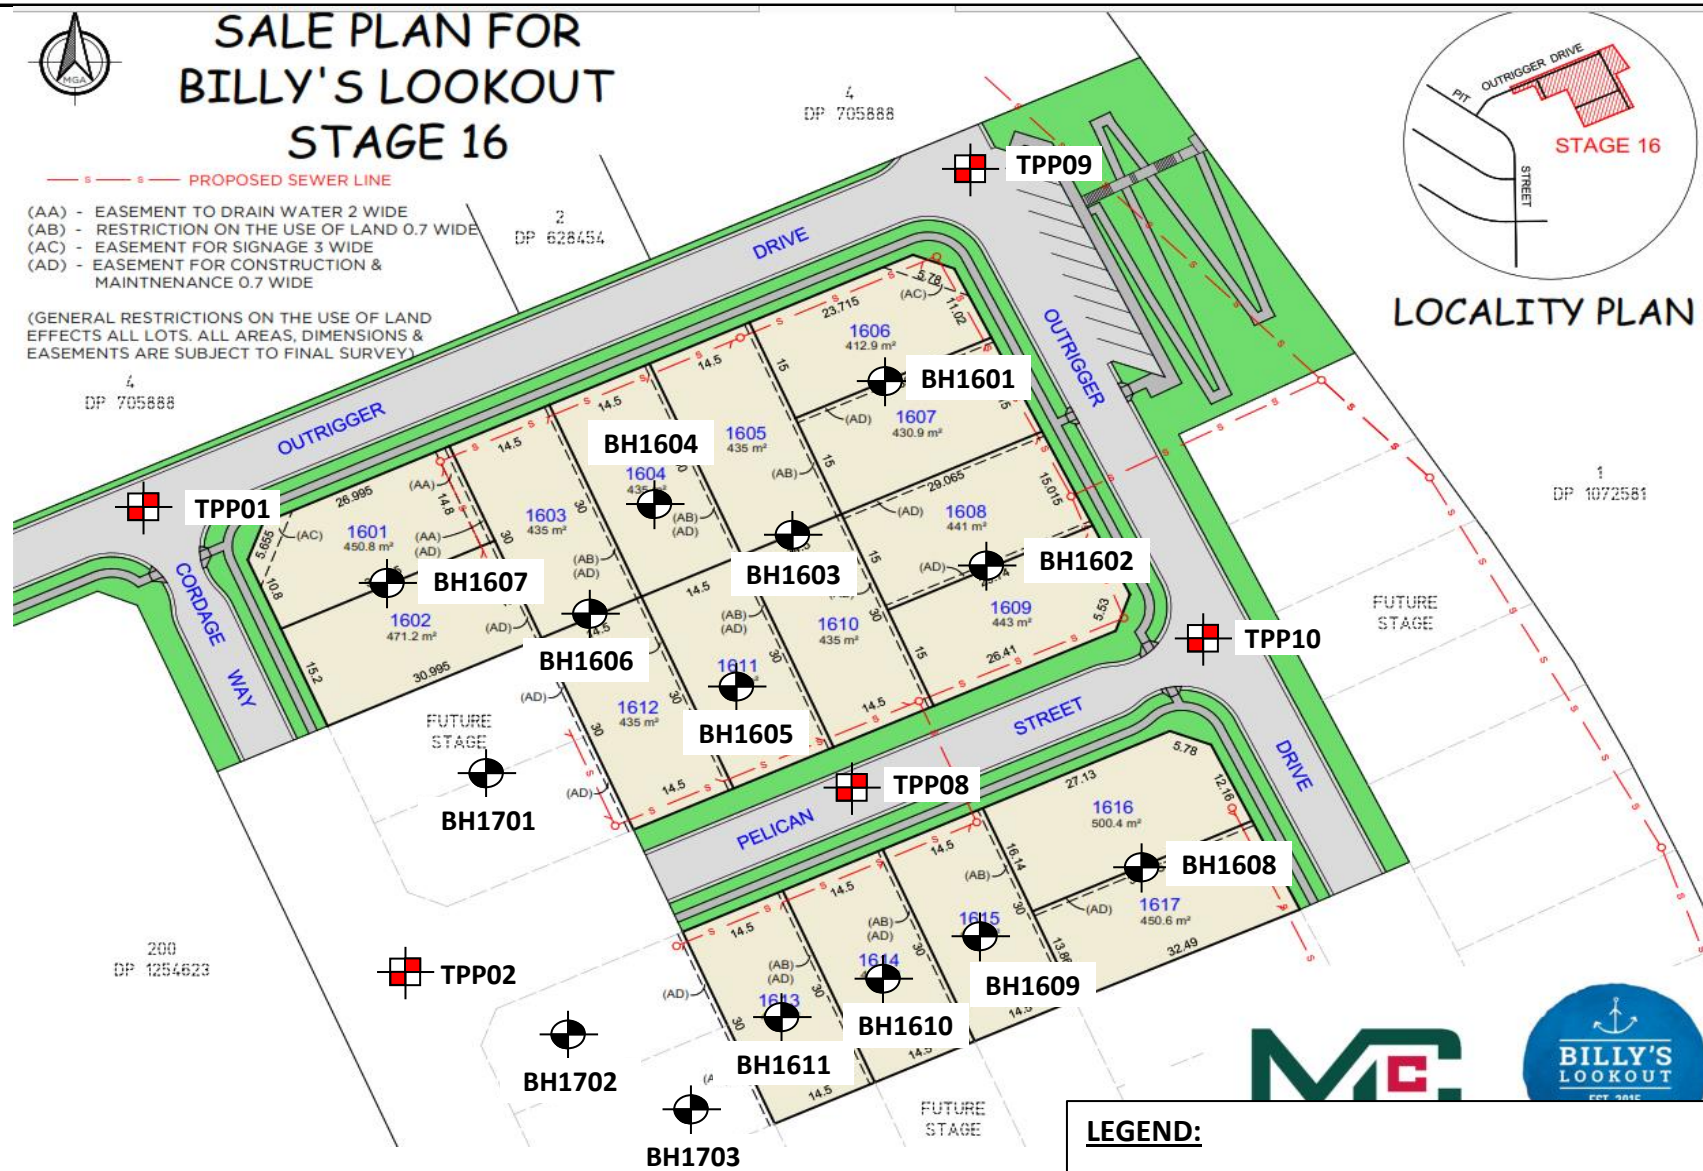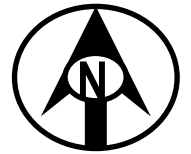

Based on Sale Plan for Billy's Lookout Stage 16 provided by client.


**LEGEND:**

- Approximate borehole location.
- 




Client:	MCCLOY GROUP	Drawing No:	FIGURE AE1
Project:	BILLYS LOOKOUT - STAGES 16 & 17	Project No:	NEW15P-0070F
Location:	OUTRIGGER DRIVE, TERALBA	Scale:	AS SHOWN
Title:	SITE PLAN AND APPROXIMATE TEST LOCATIONS	Date:	10/07/2023



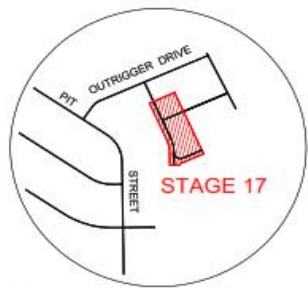

**LOCALITY PLAN**

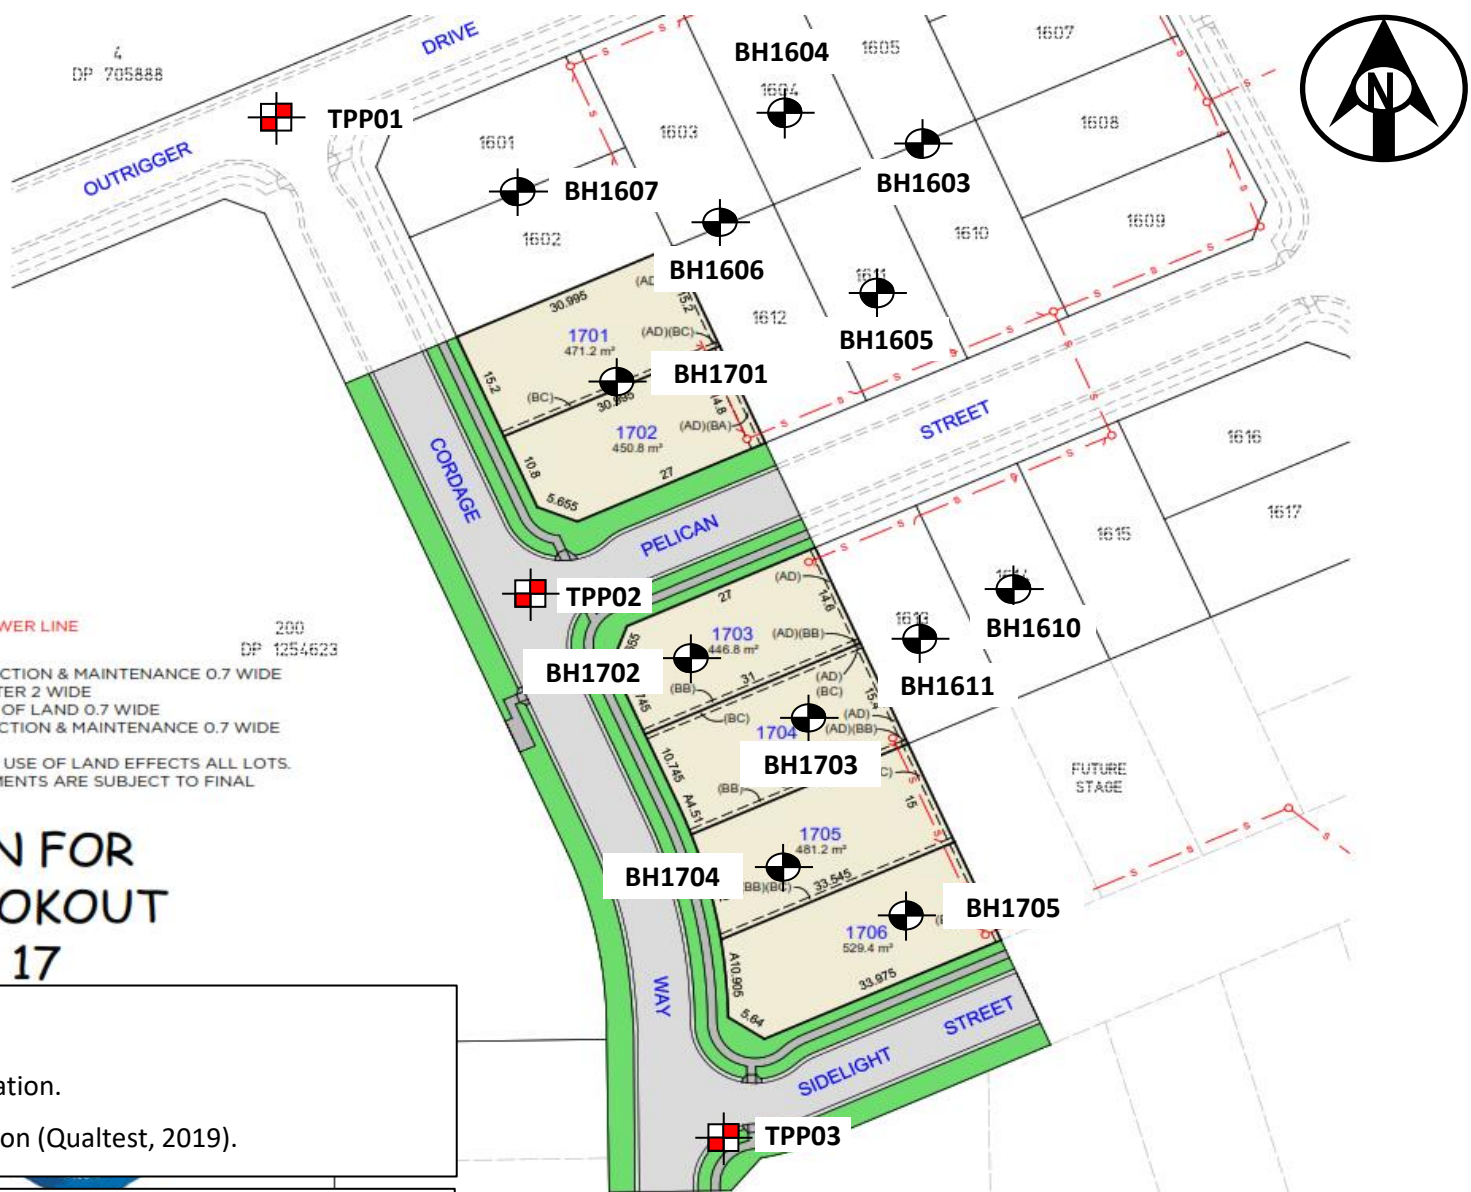

----- PROPOSED SEWER LINE

200 DP 1254623

(AD) - EASEMENT FOR CONSTRUCTION & MAINTENANCE 0.7 WIDE  
 (BA) - EASEMENT TO DRAIN WATER 2 WIDE  
 (BB) - RESTRICTION ON THE USE OF LAND 0.7 WIDE  
 (BC) - EASEMENT FOR CONSTRUCTION & MAINTENANCE 0.7 WIDE

(GENERAL RESTRICTIONS ON THE USE OF LAND EFFECTS ALL LOTS. ALL AREAS, DIMENSIONS & EASEMENTS ARE SUBJECT TO FINAL SURVEY)

**SALE PLAN FOR BILLY'S LOOKOUT STAGE 17**

**LEGEND:**

- Approximate borehole location.
- Approximate test pit location (Qualtest, 2019).

Based on Sale Plan for Billy's Lookout Stage 17 provided by client.

	Client:	MCCLOY GROUP	Drawing No:	FIGURE AE2
	Project:	BILLYS LOOKOUT - STAGES 16 & 17	Project No:	NEW15P-0070F
	Location:	OUTRIGGER DRIVE, TERALBA	Scale:	AS SHOWN
	Title:	SITE PLAN AND APPROXIMATE TEST LOCATIONS	Date:	10/07/2023

## **APPENDIX A:**

### **Results of Field Investigations**

# ENGINEERING LOG - BOREHOLE

**CLIENT:** MCCLOY GROUP  
**PROJECT:** RESIDENTIAL SUBDIVISION - STAGES 16 & 17  
**LOCATION:** BILLY'S LOOKOUT, TERALBA

**BOREHOLE NO:** BH1601  
**PAGE:** 1 OF 1  
**JOB NO:** NEW15P-0070F  
**LOGGED BY:** BE  
**DATE:** 14/6/23

**DRILL TYPE:** 2.7 TONNE EXCAVATOR WITH AUGER ATTACHMENT     **SURFACE RL:**  
**BOREHOLE DIAMETER:** 300 mm     **DATUM:**

Drilling and Sampling				Material description and profile information				Field Test		Structure and additional observations			
METHOD	WATER	SAMPLES	RL (m)	DEPTH (m)	GRAPHIC LOG	CLASSIFICATION SYMBOL	MATERIAL DESCRIPTION: Soil type, plasticity/particle characteristics, colour, minor components	MOISTURE CONDITION	CONSISTENCY DENSITY		Test Type	Result	
AD/T	Not Encountered			0.15m	[Cross-hatched pattern]	CL	FILL-TOPSOIL: Sandy CLAY - low to medium plasticity, dark grey to brown, fine to coarse grained sand, with some fine to medium grained sub-rounded to sub-angular gravel.	M ~ Wp		HP	200	FILL: TOPSOIL	
								FILL: Sandy CLAY - medium plasticity, pale orange-brown, fine to coarse grained sand, with some fine to coarse grained sub-rounded gravel.				HP	210
		0.50m		0.5	[Cross-hatched pattern]	CI		M > Wp	St - VSt	HP	210		
		U50 0.62m											
		1.30m		1.0	[Cross-hatched pattern]	GC	FILL: Clayey Sandy GRAVEL - fine to coarse grained, rounded to sub-rounded, pale orange-brown, fine to coarse grained sand, fines of medium plasticity.	M	MD				
		1.50m		1.5	[Cross-hatched pattern]	CH	FILL: CLAY - medium to high plasticity, grey, trace brown, with some fine to coarse grained sand, trace fine to medium grained rounded to sub-rounded gravel, trace silt.  With angular Sandstone cobbles, trace tree mulch.	M > Wp		HP	100	RESIDUAL SOIL	
										HP	110		
										HP	80		
										HP	100		
				2.0	[Diagonal hatched pattern]	CH	Sandy CLAY - medium to high plasticity, grey to pale brown, with orange, fine to medium grained sand.	St	HP	150			
							Hole Terminated at 2.00 m						

OT.LIB.1.1.GLB.Log\_NON-CORED BOREHOLE - TEST P.T. NEW15P-0070F BOREHOLE LOGS-STAGES 16 & 17.GPJ -<DrawingFile> 10/07/2023 18:26 10.03.00.09 Daigel Lab and In Situ Tool

<b>LEGEND:</b> <b>Water</b> Water Level (Date and time shown) Water Inflow Water Outflow <b>Strata Changes</b> Gradational or transitional strata Definitive or distinct strata change	<b>Notes, Samples and Tests</b> U <sub>30</sub> 50mm Diameter tube sample CBR Bulk sample for CBR testing E Environmental sample (Glass jar, sealed and chilled on site) ASS Acid Sulfate Soil Sample (Plastic bag, air expelled, chilled) B Bulk Sample		<b>Consistency</b> VS Very Soft S Soft F Firm St Stiff VSt Very Stiff H Hard Fb Friable		<b>UCS (kPa)</b> <25 25 - 50 50 - 100 100 - 200 200 - 400 >400	<b>Moisture Condition</b> D Dry M Moist W Wet W <sub>p</sub> Plastic Limit W <sub>L</sub> Liquid Limit
	<b>Field Tests</b> PID Photoionisation detector reading (ppm) DCP(x-y) Dynamic penetrometer test (test depth interval shown) HP Hand Penetrometer test (UCS kPa)		<b>Density</b> V Very Loose L Loose MD Medium Dense D Dense VD Very Dense		Density Index <15% Density Index 15 - 35% Density Index 35 - 65% Density Index 65 - 85% Density Index 85 - 100%	



# ENGINEERING LOG - BOREHOLE

CLIENT: MCCLOY GROUP  
 PROJECT: RESIDENTIAL SUBDIVISION - STAGES 16 & 17  
 LOCATION: BILLY'S LOOKOUT, TERALBA

BOREHOLE NO: **BH1602**  
 PAGE: 1 OF 1  
 JOB NO: NEW15P-0070F  
 LOGGED BY: BE  
 DATE: 14/6/23

DRILL TYPE: 2.7 TONNE EXCAVATOR WITH AUGER ATTACHMENT SURFACE RL:  
 BOREHOLE DIAMETER: 300 mm DATUM:

Drilling and Sampling				Material description and profile information					Field Test		Structure and additional observations		
METHOD	WATER	SAMPLES	RL (m)	DEPTH (m)	GRAPHIC LOG	CLASSIFICATION SYMBOL	MATERIAL DESCRIPTION: Soil type, plasticity/particle characteristics, colour, minor components	MOISTURE CONDITION	CONSISTENCY DENSITY	Test Type		Result	
AD/T	Not Encountered					CL	FILL-TOPSOIL: Sandy CLAY - low to medium plasticity, dark grey to brown, fine to coarse grained sand, with some fine to medium grained sub-rounded to sub-angular gravel.	M > w <sub>p</sub>				FILL: TOPSOIL	
					0.25m	GC	FILL: Clayey Sandy GRAVEL - fine to medium grained, rounded to sub-rounded, grey, fine to coarse grained sand, fines of low plasticity.					FILL - CONTROLLED / POSSIBLE RESIDUAL SOIL / EXTREMELY WEATHERED ROCK	
					0.30m	SC	Extremely Weathered Sandstone with soil properties: breaks down into Clayey SAND - fine to medium grained, orange-brown, trace pale grey, fines of low plasticity.	M	D - VD				
					0.60m		SANDSTONE - fine to medium grained, orange to pale brown with grey, estimated very low to low strength.  0.8m: Trace clay pockets/band.						HIGHLY WEATHERED ROCK
				1.0			Extremely weathered to Highly weathered.	D - M					
				1.5			1.50m: Becoming Highly Weathered (estimated low to medium strength). Hole Terminated at 1.50 m Refusal						

**LEGEND:**  
**Water**  
 Water Level (Date and time shown)  
 Water Inflow  
 Water Outflow  
**Strata Changes**  
 --- Gradational or transitional strata  
 — Definitive or distinct strata change

**Notes, Samples and Tests**  
 U<sub>30</sub> 50mm Diameter tube sample  
 CBR Bulk sample for CBR testing  
 E Environmental sample (Glass jar, sealed and chilled on site)  
 ASS Acid Sulfate Soil Sample (Plastic bag, air expelled, chilled)  
 B Bulk Sample  
**Field Tests**  
 PID Photoionisation detector reading (ppm)  
 DCP(x-y) Dynamic penetrometer test (test depth interval shown)  
 HP Hand Penetrometer test (UCS kPa)

**Consistency**  
 VS Very Soft <25  
 S Soft 25 - 50  
 F Firm 50 - 100  
 St Stiff 100 - 200  
 VSt Very Stiff 200 - 400  
 H Hard >400  
 Fb Friable

**UCS (kPa)**  
 <25  
 25 - 50  
 50 - 100  
 100 - 200  
 200 - 400  
 >400

**Density**  
 V Very Loose  
 L Loose  
 MD Medium Dense  
 D Dense  
 VD Very Dense

**Moisture Condition**  
 D Dry  
 M Moist  
 W Wet  
 W<sub>p</sub> Plastic Limit  
 W<sub>L</sub> Liquid Limit

Density Index <15%  
 Density Index 15 - 35%  
 Density Index 35 - 65%  
 Density Index 65 - 85%  
 Density Index 85 - 100%

OT LIB 1.1.GLB Log NON-CORED BOREHOLE - TEST PIT NEW15P-0070F BOREHOLE LOGS - STAGES 16 & 17.GPJ <-DrawingFile--> 10/07/2023 18:26 10.03.00.09 Daigel Lab and In Situ Tool



# ENGINEERING LOG - BOREHOLE

CLIENT: MCCLOY GROUP  
 PROJECT: RESIDENTIAL SUBDIVISION - STAGES 16 & 17  
 LOCATION: BILLY'S LOOKOUT, TERALBA

BOREHOLE NO: **BH1603**  
 PAGE: 1 OF 1  
 JOB NO: NEW15P-0070F  
 LOGGED BY: BE  
 DATE: 14/6/23

DRILL TYPE: 2.7 TONNE EXCAVATOR WITH AUGER ATTACHMENT SURFACE RL:  
 BOREHOLE DIAMETER: 300 mm DATUM:

Drilling and Sampling				Material description and profile information					Field Test		Structure and additional observations		
METHOD	WATER	SAMPLES	RL (m)	DEPTH (m)	GRAPHIC LOG	CLASSIFICATION SYMBOL	MATERIAL DESCRIPTION: Soil type, plasticity/particle characteristics, colour, minor components	MOISTURE CONDITION	CONSISTENCY DENSITY	Test Type		Result	
AD/T	Not Encountered	0.50m		0.5	[Cross-hatched pattern]	CL	FILL-TOPSOIL: Sandy CLAY / Clayey SAND - low plasticity, dark grey to brown, fine to coarse grained sand, with some fine to medium grained sub-rounded to sub-angular gravel.	M < w <sub>p</sub>				FILL - TOPSOIL	
		D											FILL - CONTROLLED
		0.70m			[Diagonal hatched pattern]	SC	FILL: Clayey Gravelly SAND / Sandy CLAY - fine to medium grained, grey to brown, fine to coarse grained rounded to sub-angular gravel, fines of low plasticity.	M	MD - D				
		1.30m											
		D		1.5	[Diagonal hatched pattern]	CH	CLAY - medium to high plasticity, grey, trace orange-brown, with some fine to coarse grained sand, trace fine to medium grained rounded to sub-rounded gravel.	M > w <sub>p</sub>	St	HP	150	RESIDUAL SOIL	
		D		1.70m									
				2.0		CH	CLAY - medium to high plasticity, pale grey to grey, trace pale orange to orange.			HP	150		
Hole Terminated at 2.00 m													

**LEGEND:**

**Water**

- Water Level (Date and time shown)
- Water Inflow
- Water Outflow

**Strata Changes**

- Gradational or transitional strata
- Definitive or distinct strata change

**Notes, Samples and Tests**

- U<sub>30</sub> 50mm Diameter tube sample
- CBR Bulk sample for CBR testing
- E Environmental sample (Glass jar, sealed and chilled on site)
- ASS Acid Sulfate Soil Sample (Plastic bag, air expelled, chilled)
- B Bulk Sample

**Field Tests**

- PID Photoionisation detector reading (ppm)
- DCP(x-y) Dynamic penetrometer test (test depth interval shown)
- HP Hand Penetrometer test (UCS kPa)

Consistency		UCS (kPa)	Moisture Condition
VS	Very Soft	<25	D Dry
S	Soft	25 - 50	M Moist
F	Firm	50 - 100	W Wet
St	Stiff	100 - 200	W <sub>p</sub> Plastic Limit
VSt	Very Stiff	200 - 400	W <sub>L</sub> Liquid Limit
H	Hard	>400	
Fb	Friable		
Density			
V	Very Loose		Density Index <15%
L	Loose		Density Index 15 - 35%
MD	Medium Dense		Density Index 35 - 65%
D	Dense		Density Index 65 - 85%
VD	Very Dense		Density Index 85 - 100%

OT LIB 1.1.GLB Log NON-CORED BOREHOLE - TEST PIT NEW15P-0070F BOREHOLE LOGS - STAGES 16 & 17.GPJ <-DrawingFile>> 10/07/2023 18:26 10.03.00.09 Daigal Lab and In Situ Tool



# ENGINEERING LOG - BOREHOLE

CLIENT: MCCLOY GROUP  
 PROJECT: RESIDENTIAL SUBDIVISION - STAGES 16 & 17  
 LOCATION: BILLY'S LOOKOUT, TERALBA

BOREHOLE NO: **BH1604**  
 PAGE: 1 OF 1  
 JOB NO: NEW15P-0070F  
 LOGGED BY: BE  
 DATE: 14/6/23

DRILL TYPE: 2.7 TONNE EXCAVATOR WITH AUGER ATTACHMENT SURFACE RL:  
 BOREHOLE DIAMETER: 300 mm DATUM:

Drilling and Sampling				Material description and profile information					Field Test		Structure and additional observations		
METHOD	WATER	SAMPLES	RL (m)	DEPTH (m)	GRAPHIC LOG	CLASSIFICATION SYMBOL	MATERIAL DESCRIPTION: Soil type, plasticity/particle characteristics, colour, minor components	MOISTURE CONDITION	CONSISTENCY DENSITY	Test Type		Result	
AD/T	Not Encountered	0.50m		0.5	[Cross-hatched pattern]	CL	FILL-TOPSOIL: Sandy CLAY / Clayey SAND - low plasticity, dark grey to brown, fine to coarse grained sand, with fine to medium grained sub-rounded to sub-angular gravel.	M < w <sub>p</sub>				FILL - TOPSOIL	
		D											FILL - CONTROLLED
		0.70m			[Cross-hatched pattern]	SC	FILL: Gravelly Clayey SAND / Sandy CLAY - fine to medium grained, grey to brown, fine to coarse grained rounded to sub-angular gravel, fines of low plasticity.	M	MD - D				
		1.90m		1.90m	[Diagonal hatched pattern]	CH	CLAY - medium to high plasticity, grey, trace orange-brown, trace fine to coarse grained sand, trace fine to medium grained rounded to sub-rounded gravel, trace rootlets.	M > w <sub>p</sub>	St	HP	180	RESIDUAL SOIL	
		D		2.00m									
							Hole Terminated at 2.10 m						

OT.LIB.1.1.GLB.Log\_NON-CORED BOREHOLE - TEST PIT\_NEW15P-0070F BOREHOLE LOGS-STAGES 16 & 17.GPJ <-DrawingFile>> 10/07/2023 18:26 10.03.00.09 Daigal Lab and In Situ Tool

<b>LEGEND:</b> <b>Water</b> Water Level (Date and time shown) Water Inflow Water Outflow <b>Strata Changes</b> Gradational or transitional strata Definitive or distinct strata change	<b>Notes, Samples and Tests</b> U <sub>30</sub> 50mm Diameter tube sample CBR Bulk sample for CBR testing E Environmental sample (Glass jar, sealed and chilled on site) ASS Acid Sulfate Soil Sample (Plastic bag, air expelled, chilled) B Bulk Sample <b>Field Tests</b> PID Photoionisation detector reading (ppm) DCP(x-y) Dynamic penetrometer test (test depth interval shown) HP Hand Penetrometer test (UCS kPa)	<b>Consistency</b> VS Very Soft S Soft F Firm St Stiff VSt Very Stiff H Hard Fb Friable	<b>UCS (kPa)</b> <25 25 - 50 50 - 100 100 - 200 200 - 400 >400	<b>Moisture Condition</b> D Dry M Moist W Wet W <sub>p</sub> Plastic Limit W <sub>L</sub> Liquid Limit
		<b>Density</b> V Very Loose L Loose MD Medium Dense D Dense VD Very Dense	Density Index <15% Density Index 15 - 35% Density Index 35 - 65% Density Index 65 - 85% Density Index 85 - 100%	



# ENGINEERING LOG - BOREHOLE

CLIENT: MCCLOY GROUP  
 PROJECT: RESIDENTIAL SUBDIVISION - STAGES 16 & 17  
 LOCATION: BILLY'S LOOKOUT, TERALBA

BOREHOLE NO: **BH1605**  
 PAGE: 1 OF 1  
 JOB NO: NEW15P-0070F  
 LOGGED BY: BE  
 DATE: 14/6/23

DRILL TYPE: 2.7 TONNE EXCAVATOR WITH AUGER ATTACHMENT SURFACE RL:  
 BOREHOLE DIAMETER: 300 mm DATUM:

Drilling and Sampling				Material description and profile information					Field Test		Structure and additional observations	
METHOD	WATER	SAMPLES	RL (m)	DEPTH (m)	GRAPHIC LOG	CLASSIFICATION SYMBOL	MATERIAL DESCRIPTION: Soil type, plasticity/particle characteristics, colour, minor components	MOISTURE CONDITION	CONSISTENCY DENSITY	Test Type		Result
AD/T	Not Encountered	D & U50 0.94m	0.80m	0.00		CL	FILL-TOPSOIL: Sandy CLAY - low to medium plasticity, dark grey to brown, fine to coarse grained sand, with some fine to medium grained sub-rounded to sub-angular gravel.	M ~ Wp				FILL - TOPSOIL
				0.20		SC	Clayey Gravelly SAND - fine to medium grained, orange to pale brown, trace pale grey, fine to medium grained rounded to sub-rounded gravel, fines of low plasticity.	M	MD		RESIDUAL SOIL / POSSIBLE CONTROLLED FILL	
				0.50		CL	Sandy Gravelly CLAY - low plasticity, orange to pale brown, with pale grey, fine to medium grained rounded gravel, fine to coarse grained sand, with some extremely weathered bands/pockets.	M ~ Wp	VSt - H	HP	350 - 450	RESIDUAL SOIL / EXTREMELY WEATHERED ROCK
				1.00		CL	Extremely Weathered Pebbly Sandstone with soil properties: breaks down into Sandy Gravelly CLAY - low plasticity, orange to pale brown, with pale grey, fine to medium grained rounded gravel, fine to coarse grained sand, with highly weathered pockets.	M < Wp	H		EXTREMELY TO HIGHLY WEATHERED ROCK	
				1.20		CL	PEBBLY SANDSTONE - fine to coarse (mostly fine to medium) grained sand in rock matrix, grey, with orange to pale orange, fine to medium grained rounded clasts, estimated low to medium strength.	D			HIGHLY WEATHERED ROCK	
				2.00			Hole Terminated at 2.00 m Practical Refusal					

OT.LIB.1.1.GLB.Log\_NON-CORED BOREHOLE - TEST PIT\_NEW15P-0070F BOREHOLE LOGS-STAGES 16 & 17.GPJ <-DrawingFile>> 10/07/2023 18:26 10.03.00.09 Daigal Lab and In Situ Tool

<b>LEGEND:</b> <b>Water</b> Water Level (Date and time shown) Water Inflow Water Outflow <b>Strata Changes</b> Gradational or transitional strata Definitive or distinct strata change	<b>Notes, Samples and Tests</b> U <sub>30</sub> 50mm Diameter tube sample CBR Bulk sample for CBR testing E Environmental sample (Glass jar, sealed and chilled on site) ASS Acid Sulfate Soil Sample (Plastic bag, air expelled, chilled) B Bulk Sample	<b>Consistency</b> VS Very Soft <25 S Soft 25 - 50 F Firm 50 - 100 St Stiff 100 - 200 VSt Very Stiff 200 - 400 H Hard >400 Fb Friable	<b>UCS (kPa)</b> <25 25 - 50 50 - 100 100 - 200 200 - 400 >400	<b>Moisture Condition</b> D Dry M Moist W Wet W <sub>p</sub> Plastic Limit W <sub>L</sub> Liquid Limit
	<b>Field Tests</b> PID Photoionisation detector reading (ppm) DCP(x-y) Dynamic penetrometer test (test depth interval shown) HP Hand Penetrometer test (UCS kPa)	<b>Density</b> V Very Loose L Loose MD Medium Dense D Dense VD Very Dense	Density Index <15% Density Index 15 - 35% Density Index 35 - 65% Density Index 65 - 85% Density Index 85 - 100%	



# ENGINEERING LOG - BOREHOLE

CLIENT: MCCLOY GROUP  
 PROJECT: RESIDENTIAL SUBDIVISION - STAGES 16 & 17  
 LOCATION: BILLY'S LOOKOUT, TERALBA

BOREHOLE NO: **BH1606**  
 PAGE: 1 OF 1  
 JOB NO: NEW15P-0070F  
 LOGGED BY: BE  
 DATE: 14/6/23

DRILL TYPE: 2.7 TONNE EXCAVATOR WITH AUGER ATTACHMENT SURFACE RL:  
 BOREHOLE DIAMETER: 300 mm DATUM:

Drilling and Sampling				Material description and profile information					Field Test		Structure and additional observations	
METHOD	WATER	SAMPLES	RL (m)	DEPTH (m)	GRAPHIC LOG	CLASSIFICATION SYMBOL	MATERIAL DESCRIPTION: Soil type, plasticity/particle characteristics, colour, minor components	MOISTURE CONDITION	CONSISTENCY DENSITY	Test Type		Result
AD/T	Not Encountered					CL	FILL-TOPSOIL: Sandy CLAY / Clayey SAND - low plasticity, dark grey to brown, fine to coarse grained sand, with some fine to medium grained sub-rounded to sub-angular gravel.	M > W <sub>p</sub>				FILL - TOPSOIL
		0.50m		0.5		SC	Clayey Gravelly SAND / Sandy CLAY - fine to medium grained, grey to brown, fine to coarse grained rounded to sub-angular gravel, fines of low plasticity.	M	MD - D			RESIDUAL SOIL / POSSIBLE CONTROLLED FILL
		0.70m		1.0		GP	Extremely Weathered Pebbly Sandstone with soil properties: breaks down into Sandy GRAVEL - fine to coarse grained, rounded to sub-rounded, pale grey and pale brown, fine to coarse grained sand, trace fines of low plasticity.	D - M	VD			EXTREMELY TO HIGHLY WEATHERED ROCK
				2.0			Hole Terminated at 2.00 m Slow progress					

**LEGEND:**

**Water**

- Water Level (Date and time shown)
- Water Inflow
- Water Outflow

**Strata Changes**

- Gradational or transitional strata
- Definitive or distinct strata change

**Notes, Samples and Tests**

- U<sub>30</sub> 50mm Diameter tube sample
- CBR Bulk sample for CBR testing
- E Environmental sample (Glass jar, sealed and chilled on site)
- ASS Acid Sulfate Soil Sample (Plastic bag, air expelled, chilled)
- B Bulk Sample

**Field Tests**

- PID Photoionisation detector reading (ppm)
- DCP(x-y) Dynamic penetrometer test (test depth interval shown)
- HP Hand Penetrometer test (UCS kPa)

Consistency		UCS (kPa)	Moisture Condition
VS	Very Soft	<25	D Dry
S	Soft	25 - 50	M Moist
F	Firm	50 - 100	W Wet
St	Stiff	100 - 200	W <sub>p</sub> Plastic Limit
VSt	Very Stiff	200 - 400	W <sub>L</sub> Liquid Limit
H	Hard	>400	
Fb	Friable		
Density			
V	Very Loose		Density Index <15%
L	Loose		Density Index 15 - 35%
MD	Medium Dense		Density Index 35 - 65%
D	Dense		Density Index 65 - 85%
VD	Very Dense		Density Index 85 - 100%

OT.LIB.1.1.GLB.Log\_NON-CORED BOREHOLE - TEST PIT\_NEW15P-0070F BOREHOLE LOGS-STAGES 16 & 17.GPJ <-DrawingFile>> 10/07/2023 18:26 10.03.00.09 Daigal Lab and In Situ Tool





# ENGINEERING LOG - BOREHOLE

CLIENT: MCCLOY GROUP  
 PROJECT: RESIDENTIAL SUBDIVISION - STAGES 16 & 17  
 LOCATION: BILLY'S LOOKOUT, TERALBA

BOREHOLE NO: **BH1607**  
 PAGE: 1 OF 1  
 JOB NO: NEW15P-0070F  
 LOGGED BY: BE  
 DATE: 14/6/23

DRILL TYPE: 2.7 TONNE EXCAVATOR WITH AUGER ATTACHMENT SURFACE RL:  
 BOREHOLE DIAMETER: 300 mm DATUM:

Drilling and Sampling				Material description and profile information					Field Test		Structure and additional observations		
METHOD	WATER	SAMPLES	RL (m)	DEPTH (m)	GRAPHIC LOG	CLASSIFICATION SYMBOL	MATERIAL DESCRIPTION: Soil type, plasticity/particle characteristics, colour, minor components	MOISTURE CONDITION	CONSISTENCY DENSITY	Test Type		Result	
AD/T	Not Encountered	0.50m		0.5	[Cross-hatched pattern]	CL	FILL-TOPSOIL: Sandy CLAY - low to medium plasticity, dark grey to brown, fine to coarse grained sand, with some fine to medium grained sub-rounded to sub-angular gravel.	M > w <sub>p</sub>	VSt	HP	350	FILL - TOPSOIL	
		D & U50				CI	FILL: Sandy Gravelly CLAY - medium plasticity, brown, with some grey, trace orange, fine to coarse grained sand, fine to coarse grained rounded to sub-rounded gravel.					HP	300
		0.75m		1.0	[Dotted pattern]	GP	Extremely Weathered Pebbly Sandstone with soil properties: breaks down into Sandy GRAVEL - fine to coarse grained, rounded to sub-rounded, pale grey and pale brown, fine to coarse grained sand, trace fines of low plasticity.	D - M	D - VD				EXTREMELY TO HIGHLY WEATHERED ROCK
				1.20m					D				
				1.40m			Hole Terminated at 1.40 m Practical Refusal						

OT.LIB.1.1.GLB.Log\_NON-CORED BOREHOLE - TEST PIT\_NEW15P-0070F BOREHOLE LOGS-STAGES 16 & 17.GPJ <-DrawingFile>> 10/07/2023 18:26 10.03.00.09 Daigal Lab and In Situ Tool

<b>LEGEND:</b> <b>Water</b> Water Level (Date and time shown) Water Inflow Water Outflow <b>Strata Changes</b> Gradational or transitional strata Definitive or distinct strata change	<b>Notes, Samples and Tests</b> U <sub>30</sub> 50mm Diameter tube sample CBR Bulk sample for CBR testing E Environmental sample (Glass jar, sealed and chilled on site) ASS Acid Sulfate Soil Sample (Plastic bag, air expelled, chilled) B Bulk Sample	<b>Consistency</b> VS Very Soft <25 S Soft 25 - 50 F Firm 50 - 100 St Stiff 100 - 200 VSt Very Stiff 200 - 400 H Hard >400 Fb Friable	<b>UCS (kPa)</b> <25 25 - 50 50 - 100 100 - 200 200 - 400 >400	<b>Moisture Condition</b> D Dry M Moist W Wet W <sub>p</sub> Plastic Limit W <sub>L</sub> Liquid Limit
	<b>Field Tests</b> PID Photoionisation detector reading (ppm) DCP(x-y) Dynamic penetrometer test (test depth interval shown) HP Hand Penetrometer test (UCS kPa)	<b>Density</b> V Very Loose L Loose MD Medium Dense D Dense VD Very Dense	Density Index <15% Density Index 15 - 35% Density Index 35 - 65% Density Index 65 - 85% Density Index 85 - 100%	



# ENGINEERING LOG - BOREHOLE

CLIENT: MCCLOY GROUP  
 PROJECT: RESIDENTIAL SUBDIVISION - STAGES 16 & 17  
 LOCATION: BILLY'S LOOKOUT, TERALBA

BOREHOLE NO: **BH1608**  
 PAGE: 1 OF 1  
 JOB NO: NEW15P-0070F  
 LOGGED BY: BE  
 DATE: 14/6/23

DRILL TYPE: 2.7 TONNE EXCAVATOR WITH AUGER ATTACHMENT SURFACE RL:  
 BOREHOLE DIAMETER: 300 mm DATUM:

Drilling and Sampling				Material description and profile information					Field Test		Structure and additional observations	
METHOD	WATER	SAMPLES	RL (m)	DEPTH (m)	GRAPHIC LOG	CLASSIFICATION SYMBOL	MATERIAL DESCRIPTION: Soil type, plasticity/particle characteristics, colour, minor components	MOISTURE CONDITION	CONSISTENCY DENSITY	Test Type		Result
AD/T	Not Encountered	D 0.15m		0.5		CL	FILL-TOPSOIL: Sandy CLAY - low to medium plasticity, dark grey to brown, fine to coarse grained sand with fine to medium grained sub-rounded to sub-angular gravel.	M > W <sub>p</sub>				FILL - TOPSOIL
						SP	Extremely Weathered Sandstone with soil properties; breaks down into Gravelly SAND - fine to coarse grained, pale brown, estimated extremely low to very low strength.	D	VD		EXTREMELY WEATHERED ROCK / HIGHLY WEATHERED ROCK	
						SANDSTONE - fine to coarse grained, pale brown, estimated low to medium strength.				HIGHLY WEATHERED ROCK		
							Hole Terminated at 0.50 m Refusal					

**LEGEND:**  
**Water**  
 Water Level (Date and time shown)  
 Water Inflow  
 Water Outflow  
**Strata Changes**  
 - - - Gradational or transitional strata  
 ——— Definitive or distinct strata change

**Notes, Samples and Tests**  
 U<sub>30</sub> 50mm Diameter tube sample  
 CBR Bulk sample for CBR testing  
 E Environmental sample (Glass jar, sealed and chilled on site)  
 ASS Acid Sulfate Soil Sample (Plastic bag, air expelled, chilled)  
 B Bulk Sample  
**Field Tests**  
 PID Photoionisation detector reading (ppm)  
 DCP(x-y) Dynamic penetrometer test (test depth interval shown)  
 HP Hand Penetrometer test (UCS kPa)

**Consistency**  
 VS Very Soft  
 S Soft  
 F Firm  
 St Stiff  
 VSt Very Stiff  
 H Hard  
 Fb Friable

**UCS (kPa)**  
 <25  
 25 - 50  
 50 - 100  
 100 - 200  
 200 - 400  
 >400

**Density**  
 V Very Loose  
 L Loose  
 MD Medium Dense  
 D Dense  
 VD Very Dense

**Moisture Condition**  
 D Dry  
 M Moist  
 W Wet  
 W<sub>p</sub> Plastic Limit  
 W<sub>L</sub> Liquid Limit

Density Index <15%  
 Density Index 15 - 35%  
 Density Index 35 - 65%  
 Density Index 65 - 85%  
 Density Index 85 - 100%



# ENGINEERING LOG - BOREHOLE

CLIENT: MCCLOY GROUP  
 PROJECT: RESIDENTIAL SUBDIVISION - STAGES 16 & 17  
 LOCATION: BILLY'S LOOKOUT, TERALBA

BOREHOLE NO: **BH1609**  
 PAGE: 1 OF 1  
 JOB NO: NEW15P-0070F  
 LOGGED BY: BE  
 DATE: 14/6/23

DRILL TYPE: 2.7 TONNE EXCAVATOR WITH AUGER ATTACHMENT SURFACE RL:  
 BOREHOLE DIAMETER: 300 mm DATUM:

Drilling and Sampling				Material description and profile information					Field Test		Structure and additional observations	
METHOD	WATER	SAMPLES	RL (m)	DEPTH (m)	GRAPHIC LOG	CLASSIFICATION SYMBOL	MATERIAL DESCRIPTION: Soil type, plasticity/particle characteristics, colour, minor components	MOISTURE CONDITION	CONSISTENCY DENSITY	Test Type		Result
AD/T	Not Encountered	D 0.15m		0.15		CL	TOPSOIL: Sandy CLAY - low plasticity, grey-brown, fine to medium grained sand, root affected.	M < W <sub>p</sub>				TOPSOIL
						SC	Extremely Weathered Sandstone with soil properties; breaks down into Gravelly Clayey SAND - fine to coarse grained, pale brown and grey, fine to coarse grained sub-angular to rounded gravel, fines of low to medium plasticity.	D - M D - VD				EXTREMELY WEATHERED ROCK
							Pebbly SANDSTONE - fine to coarse grained, brown and grey, fine to medium grained rounded clasts, estimated very low to low strength, becoming medium strength with depth. Hole Terminated at 0.55 m Refusal	D				HIGHLY WEATHERED ROCK
				0.5								
				1.0								
				1.5								
				2.0								

OT.LIB.1.1.GLB.Log\_NON-CORED BOREHOLE - TEST PIT\_NEW15P-0070F BOREHOLE LOGS-STAGES 16 & 17.GPJ <-DrawingFile--> 10/07/2023 18:26 10.03.00.09 Daigal Lab and In Situ Tool

<b>LEGEND:</b> <b>Water</b> Water Level (Date and time shown) Water Inflow Water Outflow <b>Strata Changes</b> Gradational or transitional strata Definitive or distinct strata change	<b>Notes, Samples and Tests</b> U <sub>30</sub> 50mm Diameter tube sample CBR Bulk sample for CBR testing E Environmental sample (Glass jar, sealed and chilled on site) ASS Acid Sulfate Soil Sample (Plastic bag, air expelled, chilled) B Bulk Sample	<b>Consistency</b> VS Very Soft <25 S Soft 25 - 50 F Firm 50 - 100 St Stiff 100 - 200 VSt Very Stiff 200 - 400 H Hard >400 Fb Friable	<b>UCS (kPa)</b> <25 25 - 50 50 - 100 100 - 200 200 - 400 >400	<b>Moisture Condition</b> D Dry M Moist W Wet W <sub>p</sub> Plastic Limit W <sub>L</sub> Liquid Limit
	<b>Field Tests</b> PID Photoionisation detector reading (ppm) DCP(x-y) Dynamic penetrometer test (test depth interval shown) HP Hand Penetrometer test (UCS kPa)	<b>Density</b> V Very Loose L Loose MD Medium Dense D Dense VD Very Dense	Density Index <15% Density Index 15 - 35% Density Index 35 - 65% Density Index 65 - 85% Density Index 85 - 100%	



# ENGINEERING LOG - BOREHOLE

CLIENT: MCCLOY GROUP  
 PROJECT: RESIDENTIAL SUBDIVISION - STAGES 16 & 17  
 LOCATION: BILLY'S LOOKOUT, TERALBA

BOREHOLE NO: **BH1610**  
 PAGE: 1 OF 1  
 JOB NO: NEW15P-0070F  
 LOGGED BY: BE  
 DATE: 14/6/23

DRILL TYPE: 2.7 TONNE EXCAVATOR WITH AUGER ATTACHMENT SURFACE RL:  
 BOREHOLE DIAMETER: 300 mm DATUM:

Drilling and Sampling				Material description and profile information					Field Test		Structure and additional observations
METHOD	WATER	SAMPLES	RL (m)	DEPTH (m)	GRAPHIC LOG	CLASSIFICATION SYMBOL	MATERIAL DESCRIPTION: Soil type, plasticity/particle characteristics, colour, minor components	MOISTURE CONDITION	CONSISTENCY DENSITY	Test Type	
AD/T	Not Encountered	0.15m				CL	TOPSOIL: Sandy CLAY - low plasticity, pale grey-brown, fine to medium grained sand, root affected.	M < w <sub>p</sub>			TOPSOIL
		U50 0.30m				GP	Extremely Weathered Pebbly Sandstone with soil properties; breaks down into Sandy GRAVEL - fine to medium grained, rounded to sub-rounded, brown and grey, fine to coarse grained sand, with some fines of low plasticity.	VD			EXTREMELY WEATHERED ROCK
		D 0.50m					Pebbly SANDSTONE - fine to medium grained, grey and brown, fine to medium grained rounded clasts, estimated very low to low strength.	D			HIGHLY WEATHERED ROCK
				1.0			1.00m Becoming medium strength.				
							Hole Terminated at 1.00 m Refusal				

**LEGEND:**

**Water**

- Water Level (Date and time shown)
- Water Inflow
- Water Outflow

**Strata Changes**

- Gradational or transitional strata
- Definitive or distinct strata change

**Notes, Samples and Tests**

- U<sub>30</sub> 50mm Diameter tube sample
- CBR Bulk sample for CBR testing
- E Environmental sample (Glass jar, sealed and chilled on site)
- ASS Acid Sulfate Soil Sample (Plastic bag, air expelled, chilled)
- B Bulk Sample

**Field Tests**

- PID Photoionisation detector reading (ppm)
- DCP(x-y) Dynamic penetrometer test (test depth interval shown)
- HP Hand Penetrometer test (UCS kPa)

Consistency		UCS (kPa)	Moisture Condition	
VS	Very Soft	<25	D	Dry
S	Soft	25 - 50	M	Moist
F	Firm	50 - 100	W	Wet
St	Stiff	100 - 200	W <sub>p</sub>	Plastic Limit
VSt	Very Stiff	200 - 400	W <sub>L</sub>	Liquid Limit
H	Hard	>400		
Fb	Friable			
Density				
V	Very Loose		Density Index <15%	
L	Loose		Density Index 15 - 35%	
MD	Medium Dense		Density Index 35 - 65%	
D	Dense		Density Index 65 - 85%	
VD	Very Dense		Density Index 85 - 100%	

OT LIB 1.1.GLB Log NON-CORED BOREHOLE - TEST PIT NEW15P-0070F BOREHOLE LOGS - STAGES 16 & 17.GPJ <-DrawingFile>> 10/07/2023 18:26 10.03.00.09 Daigal Lab and In Situ Tool



# ENGINEERING LOG - BOREHOLE

**CLIENT:** MCCLOY GROUP  
**PROJECT:** RESIDENTIAL SUBDIVISION - STAGES 16 & 17  
**LOCATION:** BILLY'S LOOKOUT, TERALBA

**BOREHOLE NO:** BH1611  
**PAGE:** 1 OF 1  
**JOB NO:** NEW15P-0070F  
**LOGGED BY:** BE  
**DATE:** 14/6/23

**DRILL TYPE:** 2.7 TONNE EXCAVATOR WITH AUGER ATTACHMENT **SURFACE RL:**  
**BOREHOLE DIAMETER:** 300 mm **DATUM:**

Drilling and Sampling				Material description and profile information					Field Test		Structure and additional observations	
METHOD	WATER	SAMPLES	RL (m)	DEPTH (m)	GRAPHIC LOG	CLASSIFICATION SYMBOL	MATERIAL DESCRIPTION: Soil type, plasticity/particle characteristics, colour, minor components	MOISTURE CONDITION	CONSISTENCY DENSITY	Test Type		Result
AD/T	Not Encountered					SM	TOPSOIL: Silty SAND - fine to medium grained, pale grey, fines of low plasticity, root affected.	M > W <sub>p</sub>				TOPSOIL
				0.20m		GP	Extremely Weathered Pebbly Sandstone with soil properties; breaks down into Sandy GRAVEL - fine to coarse grained, rounded, grey and brown, fine to coarse grained sand.	D - M	VD			EXTREMELY TO HIGHLY WEATHERED ROCK
				0.50m			Pebbly SANDSTONE - fine to coarse grained, grey and brown, fine to coarse grained rounded clasts, estimated very low to low strength.	D				HIGHLY WEATHERED ROCK
				0.80m			Becoming medium strength.					
				1.0			Hole Terminated at 0.80 m Practical Refusal					
				1.5								
				2.0								

OT.LIB.1.1.GLB.Log\_NON-CORED BOREHOLE - TEST PIT\_NEW15P-0070F BOREHOLE LOGS-STAGES 16 & 17.GPJ <-DrawingFile>> 10/07/2023 18:26 10.03.00.09 Daigel Lab and In Situ Tool

<b>LEGEND:</b> <b>Water</b> Water Level (Date and time shown) Water Inflow Water Outflow <b>Strata Changes</b> Gradational or transitional strata Definitive or distinct strata change	<b>Notes, Samples and Tests</b> U <sub>50</sub> 50mm Diameter tube sample CBR Bulk sample for CBR testing E Environmental sample (Glass jar, sealed and chilled on site) ASS Acid Sulfate Soil Sample (Plastic bag, air expelled, chilled) B Bulk Sample	<b>Consistency</b> VS Very Soft S Soft F Firm St Stiff VSt Very Stiff H Hard Fb Friable	<b>UCS (kPa)</b> <25 25 - 50 50 - 100 100 - 200 200 - 400 >400	<b>Moisture Condition</b> D Dry M Moist W Wet W <sub>p</sub> Plastic Limit W <sub>L</sub> Liquid Limit
	<b>Field Tests</b> PID Photoionisation detector reading (ppm) DCP(x-y) Dynamic penetrometer test (test depth interval shown) HP Hand Penetrometer test (UCS kPa)	<b>Density</b> V Very Loose L Loose MD Medium Dense D Dense VD Very Dense	Density Index <15% Density Index 15 - 35% Density Index 35 - 65% Density Index 65 - 85% Density Index 85 - 100%	



# ENGINEERING LOG - BOREHOLE

CLIENT: MCCLOY GROUP  
 PROJECT: RESIDENTIAL SUBDIVISION - STAGES 16 & 17  
 LOCATION: BILLY'S LOOKOUT, TERALBA

BOREHOLE NO: **BH1701**  
 PAGE: 1 OF 1  
 JOB NO: NEW15P-0070F  
 LOGGED BY: BE  
 DATE: 14/6/23

DRILL TYPE: 2.7 TONNE EXCAVATOR WITH AUGER ATTACHMENT SURFACE RL:  
 BOREHOLE DIAMETER: 300 mm DATUM:

Drilling and Sampling				Material description and profile information					Field Test		Structure and additional observations	
METHOD	WATER	SAMPLES	RL (m)	DEPTH (m)	GRAPHIC LOG	CLASSIFICATION SYMBOL	MATERIAL DESCRIPTION: Soil type, plasticity/particle characteristics, colour, minor components	MOISTURE CONDITION	CONSISTENCY DENSITY	Test Type		Result
AD/T	Not Encountered	0.60m		0.20m	[Cross-hatched pattern]	CL	FILL-TOPSOIL: Sandy CLAY - low to medium plasticity, dark grey to brown, fine to coarse grained sand, with some fine to medium grained sub-rounded to sub-angular gravel.	M > w <sub>p</sub>	St - VSt	HP	220	FILL - TOPSOIL
		U50	0.84m	0.5		CL	FILL: Gravelly Sandy CLAY - medium plasticity, pale brown to grey, trace orange to red-brown, fine to coarse grained sand, fine to coarse grained rounded to sub-rounded gravel.			HP	210	FILL - CONTROLLED
					1.0					HP	210	
				1.5	[Dotted pattern]		CONGLOMERATE / Pebbly SANDSTONE - fine to coarse grained clasts, grey and brown, fine to coarse grained matrix, estimated very low to low strength.	D	St	HP	120	HIGHLY WEATHERED ROCK
				1.90m		Becoming low to medium strength.	HP			120		
				2.0			Hole Terminated at 1.90 m Practical Refusal					

**LEGEND:**  
**Water**  
 Water Level (Date and time shown)  
 Water Inflow  
 Water Outflow  
**Strata Changes**  
 --- Gradational or transitional strata  
 — Definitive or distinct strata change

**Notes, Samples and Tests**  
 U<sub>30</sub> 50mm Diameter tube sample  
 CBR Bulk sample for CBR testing  
 E Environmental sample (Glass jar, sealed and chilled on site)  
 ASS Acid Sulfate Soil Sample (Plastic bag, air expelled, chilled)  
 B Bulk Sample  
**Field Tests**  
 PID Photoionisation detector reading (ppm)  
 DCP(x-y) Dynamic penetrometer test (test depth interval shown)  
 HP Hand Penetrometer test (UCS kPa)

Consistency		UCS (kPa)	Moisture Condition
VS	Very Soft	<25	D Dry
S	Soft	25 - 50	M Moist
F	Firm	50 - 100	W Wet
St	Stiff	100 - 200	W <sub>p</sub> Plastic Limit
VSt	Very Stiff	200 - 400	W <sub>L</sub> Liquid Limit
H	Hard	>400	
Fb	Friable		
Density			
V	Very Loose		Density Index <15%
L	Loose		Density Index 15 - 35%
MD	Medium Dense		Density Index 35 - 65%
D	Dense		Density Index 65 - 85%
VD	Very Dense		Density Index 85 - 100%

OT.LIB.1.1.GLB.Log\_NON-CORED BOREHOLE - TEST PIT\_NEW15P-0070F BOREHOLE LOGS-STAGES 16 & 17.GPJ <-DrawingFile--> 10/07/2023 18:26 10.03.00.09 Daigal Lab and In Situ Tool



# ENGINEERING LOG - BOREHOLE

CLIENT: MCCLOY GROUP  
 PROJECT: RESIDENTIAL SUBDIVISION - STAGES 16 & 17  
 LOCATION: BILLY'S LOOKOUT, TERALBA

BOREHOLE NO: **BH1702**  
 PAGE: 1 OF 1  
 JOB NO: NEW15P-0070F  
 LOGGED BY: BE  
 DATE: 14/6/23

DRILL TYPE: 2.7 TONNE EXCAVATOR WITH AUGER ATTACHMENT SURFACE RL:  
 BOREHOLE DIAMETER: 300 mm DATUM:

Drilling and Sampling				Material description and profile information					Field Test		Structure and additional observations					
METHOD	WATER	SAMPLES	RL (m)	DEPTH (m)	GRAPHIC LOG	CLASSIFICATION SYMBOL	MATERIAL DESCRIPTION: Soil type, plasticity/particle characteristics, colour, minor components	MOISTURE CONDITION	CONSISTENCY DENSITY	Test Type		Result				
AD/T	Not Encountered	U50 0.64m		0.25m	[Cross-hatched pattern]	CL	FILL: Sandy CLAY - low to medium plasticity, dark grey to brown, fine to coarse grained sand, with some fine to medium grained sub-rounded to sub-angular gravel.	M > W <sub>p</sub>				FILL - TOPSOIL				
				0.50m		[Diagonal hatching]	CI					Sandy CLAY - medium plasticity, pale brown to grey, trace orange to red-brown, fine to coarse grained (mostly fine to medium grained) sand, trace fine to medium grained rounded to sub-rounded gravel.	HP	320	RESIDUAL SOIL	
				0.64m	[Diagonal hatching]		CI					Gravelly Sandy CLAY - medium plasticity, pale brown to grey, trace orange to red-brown, fine to coarse grained (mostly fine to medium grained) sand, fine to coarse grained rounded to sub-rounded gravel.	VSt	HP	300	RESIDUAL SOIL / EXTREMELY WEATHERED ROCK
													HP	250		
				1.0	[Diagonal hatching]	CI						HP	200			
1.5	[Diagonal hatching]	CI		St				HP	150							
1.50m				[Stippled pattern]	GC	Sandy Clayey GRAVEL - fine to coarse grained, rounded to sub-rounded, orange-brown, trace pale grey, fines of medium plasticity, fine to coarse grained sand.	M	D - VD		RESIDUAL SOIL / EXTREMELY WEATHERED ROCK						
1.80m	[Stippled pattern]	GC	Pebbly SANDSTONE - fine to medium grained, grey and brown, fine to medium grained rounded clasts, estimated low to medium strength.							D			HIGHLY WEATHERED ROCK			
1.82m				[Stippled pattern]	GC	Hole Terminated at 1.82 m Refusal										
2.0	[Stippled pattern]	GC														

**LEGEND:**

**Water**

- Water Level (Date and time shown)
- Water Inflow
- Water Outflow

**Strata Changes**

- Gradational or transitional strata
- Definitive or distinct strata change

**Notes, Samples and Tests**

- U<sub>30</sub> 50mm Diameter tube sample
- CBR Bulk sample for CBR testing
- E Environmental sample (Glass jar, sealed and chilled on site)
- ASS Acid Sulfate Soil Sample (Plastic bag, air expelled, chilled)
- B Bulk Sample

**Field Tests**

- PID Photoionisation detector reading (ppm)
- DCP(x-y) Dynamic penetrometer test (test depth interval shown)
- HP Hand Penetrometer test (UCS kPa)

Consistency	UCS (kPa)	Moisture Condition
VS Very Soft	<25	D Dry
S Soft	25 - 50	M Moist
F Firm	50 - 100	W Wet
St Stiff	100 - 200	W <sub>p</sub> Plastic Limit
VSt Very Stiff	200 - 400	W <sub>L</sub> Liquid Limit
H Hard	>400	
Fb Friable		
Density	V Very Loose	Density Index <15%
L Loose	MD Medium Dense	Density Index 15 - 35%
D Dense	VD Very Dense	Density Index 35 - 65%
		Density Index 65 - 85%
		Density Index 85 - 100%

OT.LIB.1.1.GLB.Log\_NON-CORED BOREHOLE - TEST PIT\_NEW15P-0070F BOREHOLE LOGS-STAGES 16 & 17.GPJ <-DrawingFile--> 10/07/2023 18:26 10.03.00.09 Daigel Lab and In Situ Tool



# ENGINEERING LOG - BOREHOLE

CLIENT: MCCLOY GROUP  
 PROJECT: RESIDENTIAL SUBDIVISION - STAGES 16 & 17  
 LOCATION: BILLY'S LOOKOUT, TERALBA

BOREHOLE NO: **BH1703**  
 PAGE: 1 OF 1  
 JOB NO: NEW15P-0070F  
 LOGGED BY: BE  
 DATE: 14/6/23

DRILL TYPE: 2.7 TONNE EXCAVATOR WITH AUGER ATTACHMENT SURFACE RL:  
 BOREHOLE DIAMETER: 300 mm DATUM:

Drilling and Sampling				Material description and profile information					Field Test		Structure and additional observations			
METHOD	WATER	SAMPLES	RL (m)	DEPTH (m)	GRAPHIC LOG	CLASSIFICATION SYMBOL	MATERIAL DESCRIPTION: Soil type, plasticity/particle characteristics, colour, minor components	MOISTURE CONDITION	CONSISTENCY DENSITY	Test Type		Result		
ADT	Not Encountered	D	0.80m 1.00m	0.00	0.25	CL	FILL-TOPSOIL: Sandy CLAY - low to medium plasticity, dark grey to brown, fine to coarse grained sand, with some fine to medium grained sub-rounded to sub-angular gravel.	M > W <sub>p</sub>	St / Fb	HP	150	FILL - TOPSOIL		
				0.25	0.50	CI	Gravelly Sandy CLAY / Gravelly Clayey SAND - medium plasticity, pale brown to grey, fine to coarse grained sand, fine to coarse grained rounded to sub-rounded gravel.					RESIDUAL SOIL		
				0.50	1.20	GC	Extremely Weathered Pebbly Sandstone with soil properties; breaks down into Clayey Sandy GRAVEL - fine to medium grained, rounded to sub-rounded, grey and brown, fine to coarse grained sand, fines of low to medium plasticity.					D - M	VD	EXTREMELY WEATHERED ROCK
				1.20	1.40	CI	Gravelly Sandy CLAY - medium plasticity, pale brown to grey, fine to coarse grained sand, fine to coarse grained rounded to sub-rounded gravel.					M > W <sub>p</sub>	St	RESIDUAL SOIL
				1.40	1.60	GP	Extremely Weathered Pebbly Sandstone with soil properties; breaks down into Sandy GRAVEL - fine to coarse grained, rounded to sub-rounded, grey and brown, fine to coarse grained sand.					D - M	VD	EXTREMELY TO HIGHLY WEATHERED ROCK
				1.60	1.72		Pebbly SANDSTONE - fine to medium grained, grey and brown, fine to medium grained rounded clasts, estimated low to medium strength. Hole Terminated at 1.72 m Practical Refusal					D		HIGHLY WEATHERED ROCK

**LEGEND:**

**Water**

- Water Level (Date and time shown)
- Water Inflow
- Water Outflow

**Strata Changes**

- Gradational or transitional strata
- Definitive or distinct strata change

**Notes, Samples and Tests**

- U<sub>30</sub> 50mm Diameter tube sample
- CBR Bulk sample for CBR testing
- E Environmental sample (Glass jar, sealed and chilled on site)
- ASS Acid Sulfate Soil Sample (Plastic bag, air expelled, chilled)
- B Bulk Sample

**Field Tests**

- PID Photoionisation detector reading (ppm)
- DCP(x-y) Dynamic penetrometer test (test depth interval shown)
- HP Hand Penetrometer test (UCS kPa)

Consistency	UCS (kPa)	Moisture Condition
VS Very Soft	<25	D Dry
S Soft	25 - 50	M Moist
F Firm	50 - 100	W Wet
St Stiff	100 - 200	W <sub>p</sub> Plastic Limit
VSt Very Stiff	200 - 400	W <sub>L</sub> Liquid Limit
H Hard	>400	
Fb Friable		
Density	V Very Loose	Density Index <15%
L Loose	MD Medium Dense	Density Index 15 - 35%
D Dense	VD Very Dense	Density Index 35 - 65%
		Density Index 65 - 85%
		Density Index 85 - 100%

OT.LIB.1.1.GLB.Log\_NON-CORED BOREHOLE - TEST PIT\_NEW15P-0070F BOREHOLE LOGS-STAGES 16 & 17.GPJ <-DrawingFile>> 10/07/2023 18:26 10.03.00.09 Daigel Lab and In Situ Tool





# ENGINEERING LOG - BOREHOLE

CLIENT: MCCLOY GROUP  
 PROJECT: RESIDENTIAL SUBDIVISION - STAGES 16 & 17  
 LOCATION: BILLY'S LOOKOUT, TERALBA

BOREHOLE NO: **BH1704**  
 PAGE: 1 OF 1  
 JOB NO: NEW15P-0070F  
 LOGGED BY: BE  
 DATE: 14/6/23

DRILL TYPE: 2.7 TONNE EXCAVATOR WITH AUGER ATTACHMENT SURFACE RL:  
 BOREHOLE DIAMETER: 300 mm DATUM:

Drilling and Sampling				Material description and profile information					Field Test		Structure and additional observations			
METHOD	WATER	SAMPLES	RL (m)	DEPTH (m)	GRAPHIC LOG	CLASSIFICATION SYMBOL	MATERIAL DESCRIPTION: Soil type, plasticity/particle characteristics, colour, minor components	MOISTURE CONDITION	CONSISTENCY DENSITY	Test Type		Result		
AD/T	Not Encountered	0.40m		0.25m		CL	FILL-TOPSOIL: Sandy CLAY - low to medium plasticity, dark grey to brown, fine to coarse grained sand, with some fine to medium grained sub-rounded to sub-angular gravel.	M > W <sub>p</sub>	St - VSt	HP	150 - 350	FILL - TOPSOIL		
		U50		0.5			CI				Gravelly Sandy CLAY - medium plasticity, pale brown to grey, fine to coarse grained sand, fine to coarse grained rounded to sub-rounded gravel.	HP	150 - 350	RESIDUAL SOIL
		0.55m		1.0			GP			Extremely Weathered Pebbly Sandstone with soil properties; breaks down into Sandy GRAVEL - fine to coarse grained, rounded to sub-rounded, grey and brown, fine to coarse grained sand.	D - M	VD	HP	150 - 350
				1.10m										
				1.40m			Pebbly SANDSTONE - fine to medium grained, grey and brown, fine to medium grained rounded clasts, estimated low to medium strength.	D				HIGHLY WEATHERED ROCK		
				1.42m			Hole Terminated at 1.42 m Refusal							

**LEGEND:**  
**Water**  
 Water Level (Date and time shown)  
 Water Inflow  
 Water Outflow  
**Strata Changes**  
 --- Gradational or transitional strata  
 — Definitive or distinct strata change

**Notes, Samples and Tests**  
 U<sub>30</sub> 50mm Diameter tube sample  
 CBR Bulk sample for CBR testing  
 E Environmental sample (Glass jar, sealed and chilled on site)  
 ASS Acid Sulfate Soil Sample (Plastic bag, air expelled, chilled)  
 B Bulk Sample  
**Field Tests**  
 PID Photoionisation detector reading (ppm)  
 DCP(x-y) Dynamic penetrometer test (test depth interval shown)  
 HP Hand Penetrometer test (UCS kPa)

Consistency		UCS (kPa)	Moisture Condition
VS	Very Soft	<25	D Dry
S	Soft	25 - 50	M Moist
F	Firm	50 - 100	W Wet
St	Stiff	100 - 200	W <sub>p</sub> Plastic Limit
VSt	Very Stiff	200 - 400	W <sub>L</sub> Liquid Limit
H	Hard	>400	
Fb	Friable		
Density			
V	Very Loose		Density Index <15%
L	Loose		Density Index 15 - 35%
MD	Medium Dense		Density Index 35 - 65%
D	Dense		Density Index 65 - 85%
VD	Very Dense		Density Index 85 - 100%

OT LIB 1.1.GLB Log NON-CORED BOREHOLE - TEST PIT NEW15P-0070F BOREHOLE LOGS - STAGES 16 & 17.GPJ <-DrawingFile>> 10/07/2023 18:26 10.03.00.09 Daigel Lab and In Situ Tool



# ENGINEERING LOG - BOREHOLE

CLIENT: MCCLOY GROUP  
 PROJECT: RESIDENTIAL SUBDIVISION - STAGES 16 & 17  
 LOCATION: BILLY'S LOOKOUT, TERALBA

BOREHOLE NO: **BH1705**  
 PAGE: 1 OF 1  
 JOB NO: NEW15P-0070F  
 LOGGED BY: BE  
 DATE: 14/6/23

DRILL TYPE: 2.7 TONNE EXCAVATOR WITH AUGER ATTACHMENT SURFACE RL:  
 BOREHOLE DIAMETER: 300 mm DATUM:

Drilling and Sampling				Material description and profile information					Field Test		Structure and additional observations	
METHOD	WATER	SAMPLES	RL (m)	DEPTH (m)	GRAPHIC LOG	CLASSIFICATION SYMBOL	MATERIAL DESCRIPTION: Soil type, plasticity/particle characteristics, colour, minor components	MOISTURE CONDITION	CONSISTENCY DENSITY	Test Type		Result
AD/T	Not Encountered				0.00 - 0.20	CL	FILL-TOPSOIL: Sandy CLAY - low to medium plasticity, dark grey to brown, fine to coarse grained sand, with some fine to medium grained sub-rounded to sub-angular gravel.	M > Wp				FILL - TOPSOIL
				0.20 - 0.70	GP	Extremely Weathered Pebbly Sandstone with soil properties; breaks down into Sandy GRAVEL - fine to coarse grained, rounded to sub-rounded, grey and brown, fine to coarse grained sand, with highly weathered pockets/bands.	D - M	VD				EXTREMELY TO HIGHLY WEATHERED ROCK
				0.70 - 1.20		Pebbly SANDSTONE - fine to medium grained, orange-brown, with some pale grey, fine to medium grained rounded clasts, estimated very low to low strength.	D					
				1.20 - 1.50			Hole Terminated at 1.20 m Slow progress					

OT.LIB.1.1.GLB.Log\_NON-CORED BOREHOLE - TEST PIT\_NEW15P-0070F BOREHOLE LOGS-STAGES 16 & 17.GPJ <-DrawingFile>> 10/07/2023 18:26 10.03.00.09 Daigal Lab and In Situ Tool

<b>LEGEND:</b> <b>Water</b> Water Level (Date and time shown) Water Inflow Water Outflow <b>Strata Changes</b> Gradational or transitional strata Definitive or distinct strata change	<b>Notes, Samples and Tests</b> U <sub>30</sub> 50mm Diameter tube sample CBR Bulk sample for CBR testing E Environmental sample (Glass jar, sealed and chilled on site) ASS Acid Sulfate Soil Sample (Plastic bag, air expelled, chilled) B Bulk Sample	<b>Consistency</b> VS Very Soft S Soft F Firm St Stiff VSt Very Stiff H Hard Fb Friable	<b>UCS (kPa)</b> <25 25 - 50 50 - 100 100 - 200 200 - 400 >400	<b>Moisture Condition</b> D Dry M Moist W Wet W <sub>p</sub> Plastic Limit W <sub>L</sub> Liquid Limit
	<b>Field Tests</b> PID Photoionisation detector reading (ppm) DCP(x-y) Dynamic penetrometer test (test depth interval shown) HP Hand Penetrometer test (UCS kPa)	<b>Density</b> V Very Loose L Loose MD Medium Dense D Dense VD Very Dense	Density Index <15% Density Index 15 - 35% Density Index 35 - 65% Density Index 65 - 85% Density Index 85 - 100%	

## **APPENDIX B:**

### **Results of Laboratory Testing**


**Report No: SSI:NEW23W-2935-S01**

**Issue No: 1**

# Shrink Swell Index Report

**Client:** McCloy Development Management Pty Ltd  
 Suite 2, Ground Floor, 317 Hunter Street  
 Newcastle NSW 2300

**Project No.:** NEW15P-0070F  
**Project Name:** Billy's Lookout - Stages 16, 17 & 24  
**Project Location:** Teralba, NSW



Accredited for compliance with ISO/IEC 17025-Testing. The results of the tests, calibrations and/or measurements included in this document are traceable to Australian/national standards.  
 Results provided relate only to the items tested or sampled.

*B. Cullen*  
 Approved Signatory: Brent Cullen  
 (Engineering Geologist)  
 NATA Accredited Laboratory Number: 18686  
 Date of Issue: 22/06/2023

## Sample Details


**Sample ID:** NEW23W-2935-S01  
**Sampling Method:** The results outlined below apply to the sample as received  
**Material:** Sandy Clay  
**Source:** On-Site Insitu  
**Specification:** No Specification  
**Sample Location:** BH1601 - (0.50 - 0.62m)  
**Date Tested:** 19/06/2023

**Date Sampled:** 14/06/2023  
**Date Submitted:** 19/06/2023

Swell Test AS 1289.7.1.1	
<b>Swell on Saturation (%):</b>	-0.8
<b>Moisture Content before (%):</b>	11.1
<b>Moisture Content after (%):</b>	16.2
<b>Est. Unc. Comp. Strength before (kPa):</b>	>600
<b>Est. Unc. Comp. Strength after (kPa):</b>	>600

Shrink Test AS 1289.7.1.1	
<b>Shrink on drying (%):</b>	1.0
<b>Shrinkage Moisture Content (%):</b>	11.8
<b>Est. inert material (%):</b>	1%
<b>Crumbling during shrinkage:</b>	Nil
<b>Cracking during shrinkage:</b>	Minor

## Shrink Swell

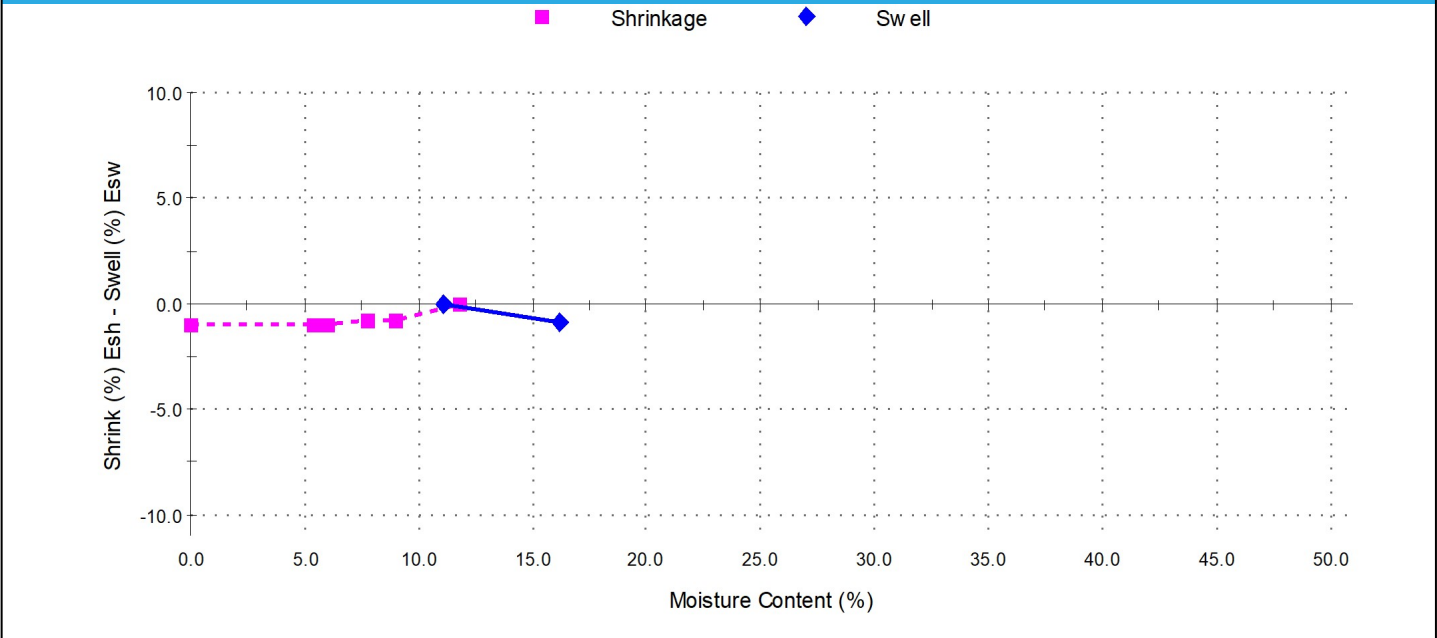

**Shrink Swell Index - Iss (%): 0.6**

## Comments

**Report No: MAT:NEW23W-2967-S01**
**Issue No: 1**

# Material Test Report

**Client:** McCloy Development Management Pty Ltd  
Suite 2, Ground Floor, 317 Hunter Street  
Newcastle NSW 2300

**Project No.:** NEW15P-0070F

**Project Name:** Billy's Lookout - Stages 16, 17 & 24

**Project Location:** Teralba, NSW



Accredited for compliance with ISO/IEC 17025 - Testing.  
Results provided relate only to the items tested or sampled.  
This report shall not be reproduced except in full.



Approved Signatory: Brent Cullen

(Engineering Geologist)

NATA Accredited Laboratory Number: 18686

Date of Issue: 5/07/2023

## Sample Details

**Sample ID:** NEW23W-2967-S01  
**Date Sampled:** 14/06/2023  
**Date Received:** 20/06/2023  
**Source:** On-Site Insitu  
**Material:** Clayey Gravelly Sand  
**Specification:** No Specification  
 The results outlined below apply to the sample as received  
**Sample Location:** BH1603 - D - (0.5 - 0.7m)

## Test Results

Description	Method	Result	Limits
Sample History	AS 1289.1.1	Oven-dried	
Preparation	AS 1289.1.1	Dry Sieved	
Linear Shrinkage (%)	AS 1289.3.4.1	5.0	
Mould Length (mm)		250	
Crumbling		No	
Curling		No	
Cracking		Yes	
Liquid Limit (%)	AS 1289.3.1.1	33	
Method		Four Point	
Plastic Limit (%)	AS 1289.3.2.1	19	
Plasticity Index (%)	AS 1289.3.3.1	14	
Date Tested		4/07/2023	

## Comments


N/A

**Report No: MAT:NEW23W-2967-S02**
**Issue No: 1**


# Material Test Report

**Client:** McCloy Development Management Pty Ltd  
 Suite 2, Ground Floor, 317 Hunter Street  
 Newcastle NSW 2300

**Project No.:** NEW15P-0070F  
**Project Name:** Billy's Lookout - Stages 16, 17 & 24  
**Project Location:** Teralba, NSW



Accredited for compliance with ISO/IEC 17025 - Testing.  
 Results provided relate only to the items tested or sampled.  
 This report shall not be reproduced except in full.

  
 Approved Signatory: Dane Cullen  
 (Materials Manager)  
 NATA Accredited Laboratory Number: 18686  
 Date of Issue: 7/07/2023

## Sample Details

**Sample ID:** NEW23W-2967-S02  
**Date Sampled:** 14/06/2023  
**Date Received:** 20/06/2023  
**Source:** On-Site Insitu  
**Material:** Clay  
**Specification:** No Specification

The results outlined below apply to the sample as received

**Sample Location:** BH1603 - D - (1.3 - 1.5m)

## Test Results

Description	Method	Result	Limits
Sample History	AS 1289.1.1	Oven-dried	
Preparation	AS 1289.1.1	Dry Sieved	
Linear Shrinkage (%)	AS 1289.3.4.1	6.0	
Mould Length (mm)		250	
Crumbling		No	
Curling		No	
Cracking		Yes	
Liquid Limit (%)	AS 1289.3.1.1	39	
Method		Four Point	
Plastic Limit (%)	AS 1289.3.2.1	24	
Plasticity Index (%)	AS 1289.3.3.1	15	
Date Tested		7/07/2023	

## Comments

N/A

**Report No: MAT:NEW23W-2967-S03**
**Issue No: 1**

# Material Test Report

**Client:** McCloy Development Management Pty Ltd  
Suite 2, Ground Floor, 317 Hunter Street  
Newcastle NSW 2300

**Project No.:** NEW15P-0070F

**Project Name:** Billy's Lookout - Stages 16, 17 & 24

**Project Location:** Teralba, NSW



Accredited for compliance with ISO/IEC 17025 - Testing.  
Results provided relate only to the items tested or sampled.  
This report shall not be reproduced except in full.



Approved Signatory: Brent Cullen

(Engineering Geologist)

NATA Accredited Laboratory Number: 18686

Date of Issue: 5/07/2023

## Sample Details

**Sample ID:** NEW23W-2967-S03  
**Date Sampled:** 14/06/2023  
**Date Received:** 20/06/2023  
**Source:** On-Site Insitu  
**Material:** Clayey Gravelly Sand  
**Specification:** No Specification  
 The results outlined below apply to the sample as received  
**Sample Location:** BH1604 - D - (0.5 - 0.7m)

## Test Results

Description	Method	Result	Limits
Sample History	AS 1289.1.1	Oven-dried	
Preparation	AS 1289.1.1	Dry Sieved	
Linear Shrinkage (%)	AS 1289.3.4.1	4.0	
Mould Length (mm)		250	
Crumbling		No	
Curling		No	
Cracking		Yes	
Liquid Limit (%)	AS 1289.3.1.1	37	
Method		Four Point	
Plastic Limit (%)	AS 1289.3.2.1	18	
Plasticity Index (%)	AS 1289.3.3.1	19	
Date Tested		4/07/2023	

## Comments


N/A

**Report No: MAT:NEW23W-2967-S04**
**Issue No: 1**


# Material Test Report

**Client:** McCloy Development Management Pty Ltd  
 Suite 2, Ground Floor, 317 Hunter Street  
 Newcastle NSW 2300

**Project No.:** NEW15P-0070F  
**Project Name:** Billy's Lookout - Stages 16, 17 & 24  
**Project Location:** Teralba, NSW



Accredited for compliance with ISO/IEC 17025 - Testing.  
 Results provided relate only to the items tested or sampled.  
 This report shall not be reproduced except in full.

  
 Approved Signatory: Dane Cullen  
 (Materials Manager)  
 NATA Accredited Laboratory Number: 18686  
 Date of Issue: 7/07/2023

## Sample Details

**Sample ID:** NEW23W-2967-S04  
**Date Sampled:** 14/06/2023  
**Date Received:** 20/06/2023  
**Source:** On-Site Insitu  
**Material:** Clay  
**Specification:** No Specification

The results outlined below apply to the sample as received

**Sample Location:** BH1604 - D - (1.9 - 2.0m)

## Test Results

Description	Method	Result	Limits
Sample History	AS 1289.1.1	Oven-dried	
Preparation	AS 1289.1.1	Dry Sieved	
Linear Shrinkage (%)	AS 1289.3.4.1	6.5	
Mould Length (mm)		250	
Crumbling		No	
Curling		No	
Cracking		Yes	
Liquid Limit (%)	AS 1289.3.1.1	43	
Method		Four Point	
Plastic Limit (%)	AS 1289.3.2.1	23	
Plasticity Index (%)	AS 1289.3.3.1	20	
Date Tested		6/07/2023	

## Comments

N/A



**Report No: MAT:NEW23W-2935-S02**
**Issue No: 1**

# Material Test Report

**Client:** McCloy Development Management Pty Ltd  
Suite 2, Ground Floor, 317 Hunter Street  
Newcastle NSW 2300

**Project No.:** NEW15P-0070F

**Project Name:** Billy's Lookout - Stages 16, 17 & 24

**Project Location:** Teralba, NSW



Accredited for compliance with ISO/IEC 17025-Testing.  
The results of the tests, calibrations and/or measurements included in this document are traceable to Australian/national standards.

Results provided relate only to the items tested or sampled.



Approved Signatory: Brent Cullen

(Engineering Geologist)

NATA Accredited Laboratory Number: 18686

Date of Issue: 26/06/2023

## Sample Details

**Sample ID:** NEW23W-2935-S02  
**Date Sampled:** 14/06/2023  
**Date Received:** 19/06/2023  
**Source:** On-Site Insitu  
**Material:** Sandy Gravelly Clay  
**Specification:** No Specification  
 The results outlined below apply to the sample as received  
**Sample Location:** BH1605 - (0.80 - 0.94m)

## Test Results

Description	Method	Result	Limits
Sample History	AS 1289.1.1	Oven-dried	
Preparation	AS 1289.1.1	Dry Sieved	
Linear Shrinkage (%)	AS 1289.3.4.1	4.0	
Mould Length (mm)		146	
Crumbling		No	
Curling		No	
Cracking		No	
Liquid Limit (%)	AS 1289.3.1.1	36	
Method		Four Point	
Plastic Limit (%)	AS 1289.3.2.1	24	
Plasticity Index (%)	AS 1289.3.3.1	12	
Date Tested		23/06/2023	

## Comments

N/A

**Report No: MAT:NEW23W-2967-S05**
**Issue No: 1**

# Material Test Report

**Client:** McCloy Development Management Pty Ltd  
Suite 2, Ground Floor, 317 Hunter Street  
Newcastle NSW 2300

**Project No.:** NEW15P-0070F

**Project Name:** Billy's Lookout - Stages 16, 17 & 24

**Project Location:** Teralba, NSW



Accredited for compliance with ISO/IEC 17025 - Testing.  
Results provided relate only to the items tested or sampled.  
This report shall not be reproduced except in full.



Approved Signatory: Dane Cullen  
(Materials Manager)

NATA Accredited Laboratory Number: 18686  
Date of Issue: 7/07/2023

## Sample Details

**Sample ID:** NEW23W-2967-S05  
**Date Sampled:** 14/06/2023  
**Date Received:** 20/06/2023  
**Source:** On-Site Insitu  
**Material:** Clayey Gravelly Sand  
**Specification:** No Specification  
 The results outlined below apply to the sample as received  
**Sample Location:** BH1606 - D - (0.5 - 0.7m)

## Test Results

Description	Method	Result	Limits
Sample History	AS 1289.1.1	Oven-dried	
Preparation	AS 1289.1.1	Dry Sieved	
Linear Shrinkage (%)	AS 1289.3.4.1	6.5	
Mould Length (mm)		250	
Crumbling		No	
Curling		No	
Cracking		Yes	
Liquid Limit (%)	AS 1289.3.1.1	36	
Method		Four Point	
Plastic Limit (%)	AS 1289.3.2.1	24	
Plasticity Index (%)	AS 1289.3.3.1	12	
Date Tested		7/07/2023	

## Comments

N/A

**Report No: MAT:NEW23W-2935-S03**
**Issue No: 1**

# Material Test Report

**Client:** McCloy Development Management Pty Ltd  
Suite 2, Ground Floor, 317 Hunter Street  
Newcastle NSW 2300

**Project No.:** NEW15P-0070F

**Project Name:** Billy's Lookout - Stages 16, 17 & 24

**Project Location:** Teralba, NSW



Accredited for compliance with ISO/IEC 17025 - Testing.  
Results provided relate only to the items tested or sampled.  
This report shall not be reproduced except in full.



Approved Signatory: Brent Cullen

(Engineering Geologist)

NATA Accredited Laboratory Number: 18686

Date of Issue: 5/07/2023

## Sample Details

**Sample ID:** NEW23W-2935-S03  
**Date Sampled:** 14/06/2023  
**Date Received:** 19/06/2023  
**Source:** On-Site Insitu  
**Material:** Sandy Gravelly Clay  
**Specification:** No Specification  
 The results outlined below apply to the sample as received  
**Sample Location:** BH1607 - (0.50 - 0.75m)

## Test Results

Description	Method	Result	Limits
Sample History	AS 1289.1.1	Oven-dried	
Preparation	AS 1289.1.1	Dry Sieved	
Linear Shrinkage (%)	AS 1289.3.4.1	4.5	
Mould Length (mm)		250	
Crumbling		No	
Curling		No	
Cracking		Yes	
Liquid Limit (%)	AS 1289.3.1.1	39	
Method		Four Point	
Plastic Limit (%)	AS 1289.3.2.1	13	
Plasticity Index (%)	AS 1289.3.3.1	26	
Date Tested		26/06/2023	

## Comments

N/A

Report No: MAT:NEW23W-2935-S04

Issue No: 1

## Material Test Report

**Client:** McCloy Development Management Pty Ltd  
Suite 2, Ground Floor, 317 Hunter Street  
Newcastle NSW 2300

**Project No.:** NEW15P-0070F

**Project Name:** Billy's Lookout - Stages 16, 17 & 24

**Project Location:** Teralba, NSW



Accredited for compliance with ISO/IEC 17025-Testing.  
The results of the tests, calibrations and/or measurements  
included in this document are traceable to Australian/national  
standards.

Results provided relate only to the items tested or sampled.

*B. Cullen*

Approved Signatory: Brent Cullen  
(Engineering Geologist)

NATA Accredited Laboratory Number: 18686  
Date of Issue: 26/06/2023

### Sample Details

**Sample ID:** NEW23W-2935-S04  
**Date Sampled:** 14/06/2023  
**Date Received:** 19/06/2023  
**Source:** On-Site Insitu  
**Material:** Sandy Clay  
**Specification:** No Specification  
The results outlined below apply to the sample as received  
**Sample Location:** BH1610 - (0.15 - 0.30m)

### Test Results

Description	Method	Result	Limits
Sample History	AS 1289.1.1	Oven-dried	
Preparation	AS 1289.1.1	Dry Sieved	
Linear Shrinkage (%)	AS 1289.3.4.1	3.5	
Mould Length (mm)		228	
Crumbling		No	
Curling		No	
Cracking		No	
Liquid Limit (%)	AS 1289.3.1.2	32	
Plastic Limit (%)	AS 1289.3.2.1	16	
Plasticity Index (%)	AS 1289.3.3.1	16	
Date Tested		23/06/2023	

### Comments

N/A


**Report No: SSI:NEW23W-2936-S01**

**Issue No: 1**

# Shrink Swell Index Report

**Client:** McCloy Development Management Pty Ltd  
 Suite 2, Ground Floor, 317 Hunter Street  
 Newcastle NSW 2300

**Project No.:** NEW15P-0070F  
**Project Name:** Billy's Lookout - Stages 16, 17 & 24  
**Project Location:** Teralba, NSW



Accredited for compliance with ISO/IEC 17025-Testing. The results of the tests, calibrations and/or measurements included in this document are traceable to Australian/national standards.  
 Results provided relate only to the items tested or sampled.


*B. Cullen*  
 Approved Signatory: Brent Cullen  
 (Engineering Geologist)  
 NATA Accredited Laboratory Number: 18686  
 Date of Issue: 22/06/2023

## Sample Details

**Sample ID:** NEW23W-2936-S01  
**Sampling Method:** The results outlined below apply to the sample as received  
**Material:** Gravelly Sandy Clay  
**Date Sampled:** 14/06/2023  
**Source:** On-Site Insitu  
**Date Submitted:** 19/06/2023  
**Specification:** No Specification  
**Sample Location:** BH1701 - (0.60 - 0.84m)  
**Date Tested:** 19/06/2023

Swell Test AS 1289.7.1.1		Shrink Test AS 1289.7.1.1	
<b>Swell on Saturation (%):</b>	-1.2	<b>Shrink on drying (%):</b>	0.7
<b>Moisture Content before (%):</b>	11.6	<b>Shrinkage Moisture Content (%):</b>	12.7
<b>Moisture Content after (%):</b>	13.2	<b>Est. inert material (%):</b>	1%
<b>Est. Unc. Comp. Strength before (kPa):</b>	260	<b>Crumbling during shrinkage:</b>	Nil
<b>Est. Unc. Comp. Strength after (kPa):</b>	340	<b>Cracking during shrinkage:</b>	Minor

## Shrink Swell

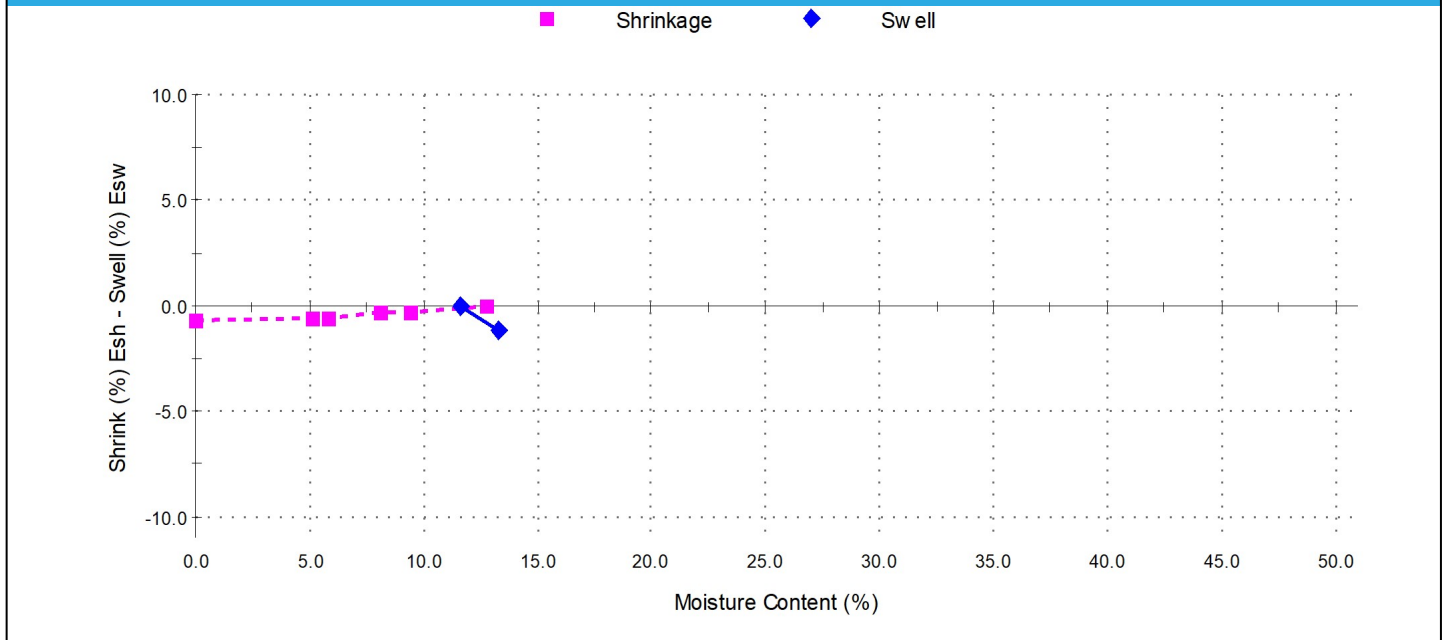

**Shrink Swell Index - Iss (%): 0.4**

## Comments


**Report No: SSI:NEW23W-2936-S02**

**Issue No: 1**

# Shrink Swell Index Report

**Client:** McCloy Development Management Pty Ltd  
 Suite 2, Ground Floor, 317 Hunter Street  
 Newcastle NSW 2300

**Project No.:** NEW15P-0070F  
**Project Name:** Billy's Lookout - Stages 16, 17 & 24  
**Project Location:** Teralba, NSW



Accredited for compliance with ISO/IEC 17025-Testing. The results of the tests, calibrations and/or measurements included in this document are traceable to Australian/national standards.  
 Results provided relate only to the items tested or sampled.


*B. Cullen*  
 Approved Signatory: Brent Cullen  
 (Engineering Geologist)  
 NATA Accredited Laboratory Number: 18686  
 Date of Issue: 22/06/2023

## Sample Details

**Sample ID:** NEW23W-2936-S02  
**Sampling Method:** The results outlined below apply to the sample as received  
**Material:** Sandy CLAY  
**Date Sampled:** 14/06/2023  
**Source:** On-Site Insitu  
**Date Submitted:** 19/06/2023  
**Specification:** No Specification  
**Sample Location:** BH1702 - (0.50 - 0.64m)  
**Date Tested:** 19/06/2023

Swell Test AS 1289.7.1.1		Shrink Test AS 1289.7.1.1	
<b>Swell on Saturation (%):</b>	-1.0	<b>Shrink on drying (%):</b>	1.2
<b>Moisture Content before (%):</b>	11.6	<b>Shrinkage Moisture Content (%):</b>	13.1
<b>Moisture Content after (%):</b>	14.1	<b>Est. inert material (%):</b>	1%
<b>Est. Unc. Comp. Strength before (kPa):</b>	>600	<b>Crumbling during shrinkage:</b>	Nil
<b>Est. Unc. Comp. Strength after (kPa):</b>	590	<b>Cracking during shrinkage:</b>	Minor

## Shrink Swell

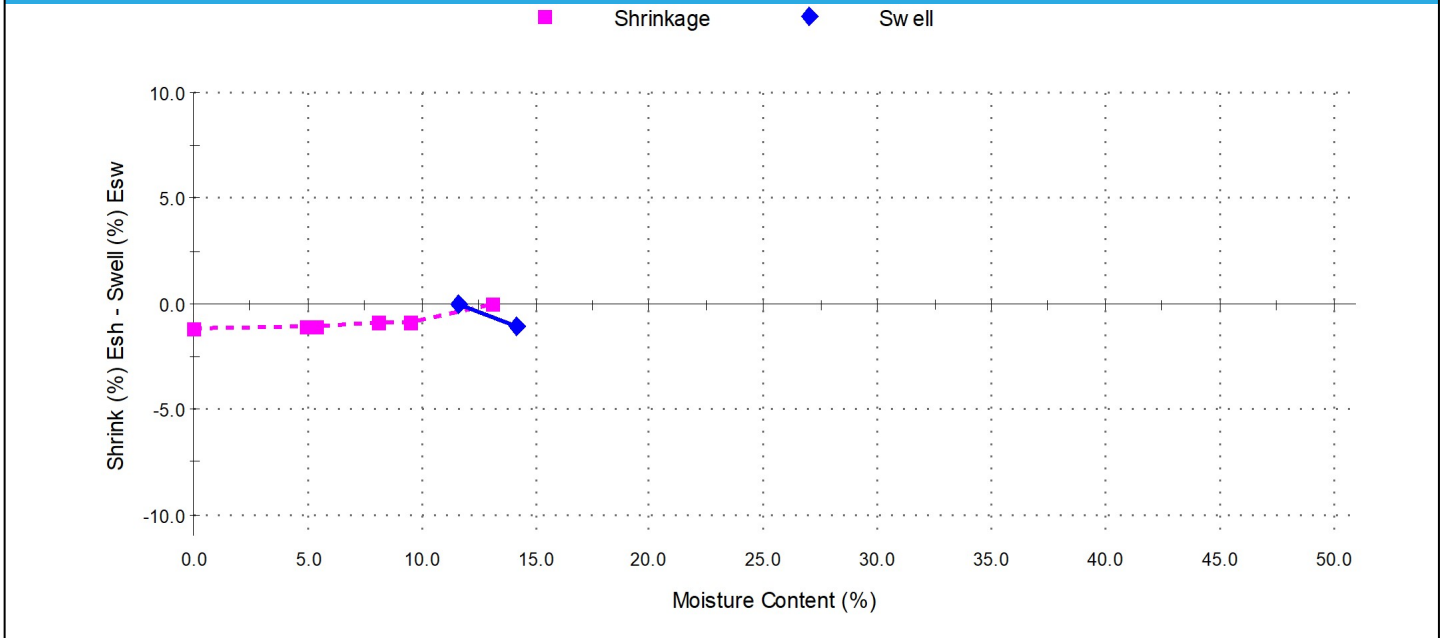

**Shrink Swell Index - Iss (%): 0.7**

## Comments

**Report No: MAT:NEW23W-2967-S06**
**Issue No: 1**

# Material Test Report

**Client:** McCloy Development Management Pty Ltd  
Suite 2, Ground Floor, 317 Hunter Street  
Newcastle NSW 2300

**Project No.:** NEW15P-0070F

**Project Name:** Billy's Lookout - Stages 16, 17 & 24

**Project Location:** Teralba, NSW



Accredited for compliance with ISO/IEC 17025 - Testing.  
Results provided relate only to the items tested or sampled.  
This report shall not be reproduced except in full.



Approved Signatory: Dane Cullen  
(Materials Manager)

NATA Accredited Laboratory Number: 18686  
Date of Issue: 7/07/2023

## Sample Details

**Sample ID:** NEW23W-2967-S06  
**Date Sampled:** 14/06/2023  
**Date Received:** 20/06/2023  
**Source:** On-Site Insitu  
**Material:** Gravelly Sandy Clay  
**Specification:** No Specification  
**Sample Location:** The results outlined below apply to the sample as received  
BH1703 - D - (0.8 - 1.0m)

## Test Results

Description	Method	Result	Limits
Sample History	AS 1289.1.1	Oven-dried	
Preparation	AS 1289.1.1	Dry Sieved	
Linear Shrinkage (%)	AS 1289.3.4.1	3.5	
Mould Length (mm)		250	
Crumbling		No	
Curling		No	
Cracking		Yes	
Liquid Limit (%)	AS 1289.3.1.1	30	
Method		Four Point	
Plastic Limit (%)	AS 1289.3.2.1	18	
Plasticity Index (%)	AS 1289.3.3.1	12	
Date Tested		4/07/2023	

## Comments

N/A


**Report No: SSI:NEW23W-2936-S03**

**Issue No: 1**

# Shrink Swell Index Report

**Client:** McCloy Development Management Pty Ltd  
 Suite 2, Ground Floor, 317 Hunter Street  
 Newcastle NSW 2300

**Project No.:** NEW15P-0070F  
**Project Name:** Billy's Lookout - Stages 16, 17 & 24  
**Project Location:** Teralba, NSW



Accredited for compliance with ISO/IEC 17025-Testing.  
 The results of the tests, calibrations and/or measurements included in this document are traceable to Australian/national standards.  
 Results provided relate only to the items tested or sampled.


*B. Cullen*  
 Approved Signatory: Brent Cullen  
 (Engineering Geologist)  
 NATA Accredited Laboratory Number: 18686  
 Date of Issue: 22/06/2023

## Sample Details

**Sample ID:** NEW23W-2936-S03  
**Sampling Method:** The results outlined below apply to the sample as received  
**Material:** Gravelly Sandy CLAY  
**Date Sampled:** 14/06/2023  
**Source:** On-Site Insitu  
**Date Submitted:** 19/06/2023  
**Specification:** No Specification  
**Sample Location:** BH1704 - (0.40 - 0.55m)  
**Date Tested:** 19/06/2023

Swell Test AS 1289.7.1.1		Shrink Test AS 1289.7.1.1	
<b>Swell on Saturation (%):</b>	-0.9	<b>Shrink on drying (%):</b>	0.9
<b>Moisture Content before (%):</b>	8.9	<b>Shrinkage Moisture Content (%):</b>	11.4
<b>Moisture Content after (%):</b>	14.7	<b>Est. inert material (%):</b>	1%
<b>Est. Unc. Comp. Strength before (kPa):</b>	440	<b>Crumbling during shrinkage:</b>	Nil
<b>Est. Unc. Comp. Strength after (kPa):</b>	410	<b>Cracking during shrinkage:</b>	Minor

## Shrink Swell

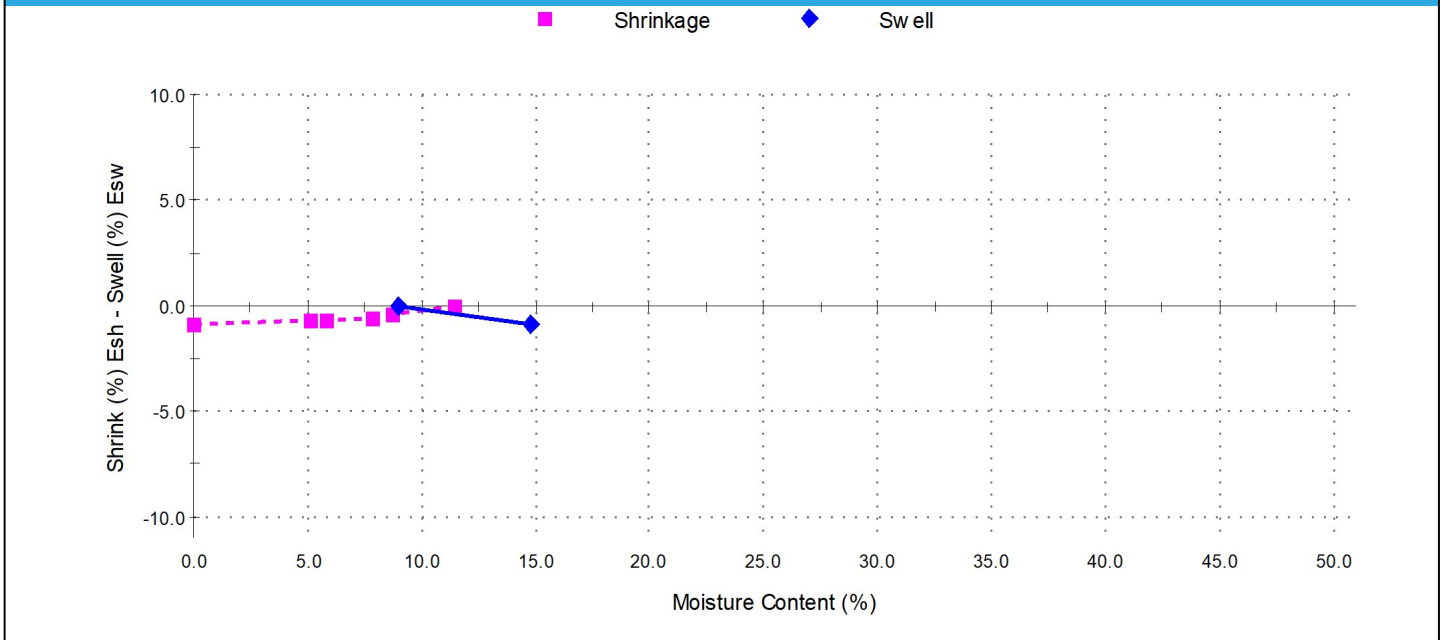

**Shrink Swell Index - Iss (%): 0.5**

## Comments



# **APPENDIX C:**

**CSIRO Sheet BTF 18**

**Foundation Maintenance and Footing  
Performance: A Homeowner's Guide**

# Foundation Maintenance and Footing Performance: A Homeowner's Guide



CSIRO

BTF 18  
replaces  
Information  
Sheet 10/91

Buildings can and often do move. This movement can be up, down, lateral or rotational. The fundamental cause of movement in buildings can usually be related to one or more problems in the foundation soil. It is important for the homeowner to identify the soil type in order to ascertain the measures that should be put in place in order to ensure that problems in the foundation soil can be prevented, thus protecting against building movement.

This Building Technology File is designed to identify causes of soil-related building movement, and to suggest methods of prevention of resultant cracking in buildings.

## Soil Types

The types of soils usually present under the topsoil in land zoned for residential buildings can be split into two approximate groups – granular and clay. Quite often, foundation soil is a mixture of both types. The general problems associated with soils having granular content are usually caused by erosion. Clay soils are subject to saturation and swell/shrink problems.

Classifications for a given area can generally be obtained by application to the local authority, but these are sometimes unreliable and if there is doubt, a geotechnical report should be commissioned. As most buildings suffering movement problems are founded on clay soils, there is an emphasis on classification of soils according to the amount of swell and shrinkage they experience with variations of water content. The table below is Table 2.1 from AS 2870, the Residential Slab and Footing Code.

## Causes of Movement

### Settlement due to construction

There are two types of settlement that occur as a result of construction:

- Immediate settlement occurs when a building is first placed on its foundation soil, as a result of compaction of the soil under the weight of the structure. The cohesive quality of clay soil mitigates against this, but granular (particularly sandy) soil is susceptible.
- Consolidation settlement is a feature of clay soil and may take place because of the expulsion of moisture from the soil or because of the soil's lack of resistance to local compressive or shear stresses. This will usually take place during the first few months after construction, but has been known to take many years in exceptional cases.

These problems are the province of the builder and should be taken into consideration as part of the preparation of the site for construction. Building Technology File 19 (BTF 19) deals with these problems.

### Erosion

All soils are prone to erosion, but sandy soil is particularly susceptible to being washed away. Even clay with a sand component of say 10% or more can suffer from erosion.

### Saturation

This is particularly a problem in clay soils. Saturation creates a bog-like suspension of the soil that causes it to lose virtually all of its bearing capacity. To a lesser degree, sand is affected by saturation because saturated sand may undergo a reduction in volume – particularly imported sand fill for bedding and blinding layers. However, this usually occurs as immediate settlement and should normally be the province of the builder.

### Seasonal swelling and shrinkage of soil

All clays react to the presence of water by slowly absorbing it, making the soil increase in volume (see table below). The degree of increase varies considerably between different clays, as does the degree of decrease during the subsequent drying out caused by fair weather periods. Because of the low absorption and expulsion rate, this phenomenon will not usually be noticeable unless there are prolonged rainy or dry periods, usually of weeks or months, depending on the land and soil characteristics.

The swelling of soil creates an upward force on the footings of the building, and shrinkage creates subsidence that takes away the support needed by the footing to retain equilibrium.

### Shear failure

This phenomenon occurs when the foundation soil does not have sufficient strength to support the weight of the footing. There are two major post-construction causes:

- Significant load increase.
- Reduction of lateral support of the soil under the footing due to erosion or excavation.
- In clay soil, shear failure can be caused by saturation of the soil adjacent to or under the footing.

## GENERAL DEFINITIONS OF SITE CLASSES

Class	Foundation
A	Most sand and rock sites with little or no ground movement from moisture changes
S	Slightly reactive clay sites with only slight ground movement from moisture changes
M	Moderately reactive clay or silt sites, which can experience moderate ground movement from moisture changes
H	Highly reactive clay sites, which can experience high ground movement from moisture changes
E	Extremely reactive sites, which can experience extreme ground movement from moisture changes
A to P	Filled sites
P	Sites which include soft soils, such as soft clay or silt or loose sands; landslip; mine subsidence; collapsing soils; soils subject to erosion; reactive sites subject to abnormal moisture conditions or sites which cannot be classified otherwise

### Tree root growth

Trees and shrubs that are allowed to grow in the vicinity of footings can cause foundation soil movement in two ways:

- Roots that grow under footings may increase in cross-sectional size, exerting upward pressure on footings.
- Roots in the vicinity of footings will absorb much of the moisture in the foundation soil, causing shrinkage or subsidence.

### Unevenness of Movement

The types of ground movement described above usually occur unevenly throughout the building's foundation soil. Settlement due to construction tends to be uneven because of:

- Differing compaction of foundation soil prior to construction.
- Differing moisture content of foundation soil prior to construction.

Movement due to non-construction causes is usually more uneven still. Erosion can undermine a footing that traverses the flow or can create the conditions for shear failure by eroding soil adjacent to a footing that runs in the same direction as the flow.

Saturation of clay foundation soil may occur where subfloor walls create a dam that makes water pond. It can also occur wherever there is a source of water near footings in clay soil. This leads to a severe reduction in the strength of the soil which may create local shear failure.

Seasonal swelling and shrinkage of clay soil affects the perimeter of the building first, then gradually spreads to the interior. The swelling process will usually begin at the uphill extreme of the building, or on the weather side where the land is flat. Swelling gradually reaches the interior soil as absorption continues. Shrinkage usually begins where the sun's heat is greatest.

### Effects of Uneven Soil Movement on Structures

#### Erosion and saturation

Erosion removes the support from under footings, tending to create subsidence of the part of the structure under which it occurs. Brickwork walls will resist the stress created by this removal of support by bridging the gap or cantilevering until the bricks or the mortar bedding fail. Older masonry has little resistance. Evidence of failure varies according to circumstances and symptoms may include:

- Step cracking in the mortar beds in the body of the wall or above/below openings such as doors or windows.
- Vertical cracking in the bricks (usually but not necessarily in line with the vertical beds or perpend).

Isolated piers affected by erosion or saturation of foundations will eventually lose contact with the bearers they support and may tilt or fall over. The floors that have lost this support will become bouncy, sometimes rattling ornaments etc.

#### Seasonal swelling/shrinkage in clay

Swelling foundation soil due to rainy periods first lifts the most exposed extremities of the footing system, then the remainder of the perimeter footings while gradually permeating inside the building footprint to lift internal footings. This swelling first tends to create a dish effect, because the external footings are pushed higher than the internal ones.

The first noticeable symptom may be that the floor appears slightly dished. This is often accompanied by some doors binding on the floor or the door head, together with some cracking of cornice mitres. In buildings with timber flooring supported by bearers and joists, the floor can be bouncy. Externally there may be visible dishing of the hip or ridge lines.

As the moisture absorption process completes its journey to the innermost areas of the building, the internal footings will rise. If the spread of moisture is roughly even, it may be that the symptoms will temporarily disappear, but it is more likely that swelling will be uneven, creating a difference rather than a disappearance in symptoms. In buildings with timber flooring supported by bearers and joists, the isolated piers will rise more easily than the strip footings or piers under walls, creating noticeable doming of flooring.

### Trees can cause shrinkage and damage



As the weather pattern changes and the soil begins to dry out, the external footings will be first affected, beginning with the locations where the sun's effect is strongest. This has the effect of lowering the external footings. The doming is accentuated and cracking reduces or disappears where it occurred because of dishing, but other cracks open up. The roof lines may become convex.

Doming and dishing are also affected by weather in other ways. In areas where warm, wet summers and cooler dry winters prevail, water migration tends to be toward the interior and doming will be accentuated, whereas where summers are dry and winters are cold and wet, migration tends to be toward the exterior and the underlying propensity is toward dishing.

#### Movement caused by tree roots

In general, growing roots will exert an upward pressure on footings, whereas soil subject to drying because of tree or shrub roots will tend to remove support from under footings by inducing shrinkage.

#### Complications caused by the structure itself

Most forces that the soil causes to be exerted on structures are vertical – i.e. either up or down. However, because these forces are seldom spread evenly around the footings, and because the building resists uneven movement because of its rigidity, forces are exerted from one part of the building to another. The net result of all these forces is usually rotational. This resultant force often complicates the diagnosis because the visible symptoms do not simply reflect the original cause. A common symptom is binding of doors on the vertical member of the frame.

#### Effects on full masonry structures

Brickwork will resist cracking where it can. It will attempt to span areas that lose support because of subsided foundations or raised points. It is therefore usual to see cracking at weak points, such as openings for windows or doors.

In the event of construction settlement, cracking will usually remain unchanged after the process of settlement has ceased.

With local shear or erosion, cracking will usually continue to develop until the original cause has been remedied, or until the subsidence has completely neutralised the affected portion of footing and the structure has stabilised on other footings that remain effective.

In the case of swell/shrink effects, the brickwork will in some cases return to its original position after completion of a cycle, however it is more likely that the rotational effect will not be exactly reversed, and it is also usual that brickwork will settle in its new position and will resist the forces trying to return it to its original position. This means that in a case where swelling takes place after construction and cracking occurs, the cracking is likely to at least partly remain after the shrink segment of the cycle is complete. Thus, each time the cycle is repeated, the likelihood is that the cracking will become wider until the sections of brickwork become virtually independent.

With repeated cycles, once the cracking is established, if there is no other complication, it is normal for the incidence of cracking to stabilise, as the building has the articulation it needs to cope with the problem. This is by no means always the case, however, and monitoring of cracks in walls and floors should always be treated seriously.

Upheaval caused by growth of tree roots under footings is not a simple vertical shear stress. There is a tendency for the root to also exert lateral forces that attempt to separate sections of brickwork after initial cracking has occurred.

The normal structural arrangement is that the inner leaf of brickwork in the external walls and at least some of the internal walls (depending on the roof type) comprise the load-bearing structure on which any upper floors, ceilings and the roof are supported. In these cases, it is internally visible cracking that should be the main focus of attention, however there are a few examples of dwellings whose external leaf of masonry plays some supporting role, so this should be checked if there is any doubt. In any case, externally visible cracking is important as a guide to stresses on the structure generally, and it should also be remembered that the external walls must be capable of supporting themselves.

#### Effects on framed structures

Timber or steel framed buildings are less likely to exhibit cracking due to swell/shrink than masonry buildings because of their flexibility. Also, the doming/dishing effects tend to be lower because of the lighter weight of walls. The main risks to framed buildings are encountered because of the isolated pier footings used under walls. Where erosion or saturation cause a footing to fall away, this can double the span which a wall must bridge. This additional stress can create cracking in wall linings, particularly where there is a weak point in the structure caused by a door or window opening. It is, however, unlikely that framed structures will be so stressed as to suffer serious damage without first exhibiting some or all of the above symptoms for a considerable period. The same warning period should apply in the case of upheaval. It should be noted, however, that where framed buildings are supported by strip footings there is only one leaf of brickwork and therefore the externally visible walls are the supporting structure for the building. In this case, the subfloor masonry walls can be expected to behave as full brickwork walls.

#### Effects on brick veneer structures

Because the load-bearing structure of a brick veneer building is the frame that makes up the interior leaf of the external walls plus perhaps the internal walls, depending on the type of roof, the building can be expected to behave as a framed structure, except that the external masonry will behave in a similar way to the external leaf of a full masonry structure.

### Water Service and Drainage

Where a water service pipe, a sewer or stormwater drainage pipe is in the vicinity of a building, a water leak can cause erosion, swelling or saturation of susceptible soil. Even a minuscule leak can be enough to saturate a clay foundation. A leaking tap near a building can have the same effect. In addition, trenches containing pipes can become watercourses even though backfilled, particularly where broken rubble is used as fill. Water that runs along these trenches can be responsible for serious erosion, interstrata seepage into subfloor areas and saturation.

Pipe leakage and trench water flows also encourage tree and shrub roots to the source of water, complicating and exacerbating the problem.

Poor roof plumbing can result in large volumes of rainwater being concentrated in a small area of soil:

- Incorrect falls in roof guttering may result in overflows, as may gutters blocked with leaves etc.

- Corroded guttering or downpipes can spill water to ground.
- Downpipes not positively connected to a proper stormwater collection system will direct a concentration of water to soil that is directly adjacent to footings, sometimes causing large-scale problems such as erosion, saturation and migration of water under the building.

### Seriousness of Cracking

In general, most cracking found in masonry walls is a cosmetic nuisance only and can be kept in repair or even ignored. The table below is a reproduction of Table C1 of AS 2870.

AS 2870 also publishes figures relating to cracking in concrete floors, however because wall cracking will usually reach the critical point significantly earlier than cracking in slabs, this table is not reproduced here.

### Prevention/Cure

#### Plumbing

Where building movement is caused by water service, roof plumbing, sewer or stormwater failure, the remedy is to repair the problem. It is prudent, however, to consider also rerouting pipes away from the building where possible, and relocating taps to positions where any leakage will not direct water to the building vicinity. Even where gully traps are present, there is sometimes sufficient spill to create erosion or saturation, particularly in modern installations using smaller diameter PVC fixtures. Indeed, some gully traps are not situated directly under the taps that are installed to charge them, with the result that water from the tap may enter the backfilled trench that houses the sewer piping. If the trench has been poorly backfilled, the water will either pond or flow along the bottom of the trench. As these trenches usually run alongside the footings and can be at a similar depth, it is not hard to see how any water that is thus directed into a trench can easily affect the foundation's ability to support footings or even gain entry to the subfloor area.

#### Ground drainage

In all soils there is the capacity for water to travel on the surface and below it. Surface water flows can be established by inspection during and after heavy or prolonged rain. If necessary, a grated drain system connected to the stormwater collection system is usually an easy solution.

It is, however, sometimes necessary when attempting to prevent water migration that testing be carried out to establish watertable height and subsoil water flows. This subject is referred to in BTF 19 and may properly be regarded as an area for an expert consultant.


#### Protection of the building perimeter

It is essential to remember that the soil that affects footings extends well beyond the actual building line. Watering of garden plants, shrubs and trees causes some of the most serious water problems.

For this reason, particularly where problems exist or are likely to occur, it is recommended that an apron of paving be installed around as much of the building perimeter as necessary. This paving

### CLASSIFICATION OF DAMAGE WITH REFERENCE TO WALLS

Description of typical damage and required repair	Approximate crack width limit (see Note 3)	Damage category
Hairline cracks	<0.1 mm	0
Fine cracks which do not need repair	<1 mm	1
Cracks noticeable but easily filled. Doors and windows stick slightly	<5 mm	2
Cracks can be repaired and possibly a small amount of wall will need to be replaced. Doors and windows stick. Service pipes can fracture. Weathertightness often impaired	5–15 mm (or a number of cracks 3 mm or more in one group)	3
Extensive repair work involving breaking-out and replacing sections of walls, especially over doors and windows. Window and door frames distort. Walls lean or bulge noticeably, some loss of bearing in beams. Service pipes disrupted	15–25 mm but also depend on number of cracks	4

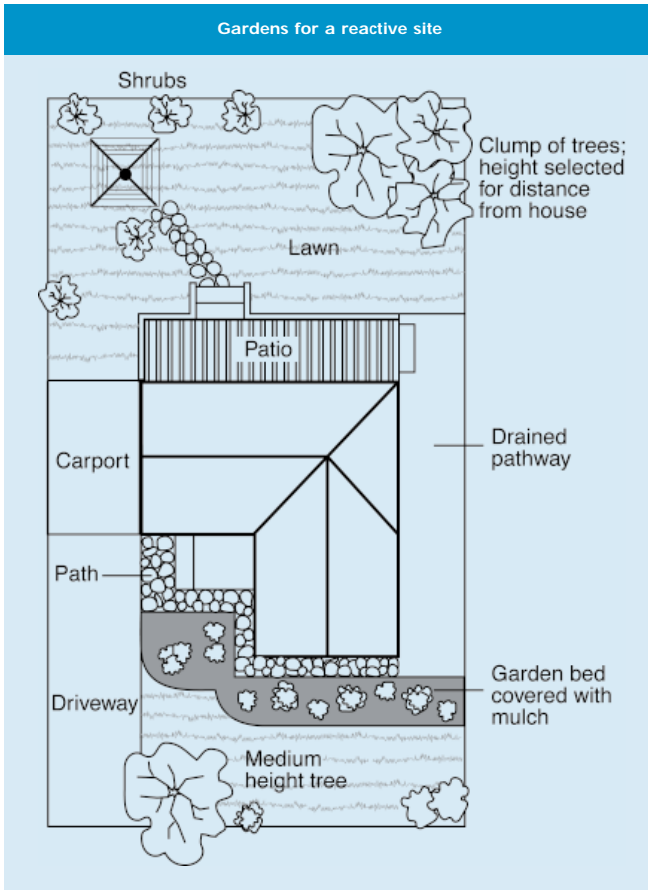

- Water that is transmitted into masonry, metal or timber building elements causes damage and/or decay to those elements.
- High subfloor humidity and moisture content create an ideal environment for various pests, including termites and spiders.
- Where high moisture levels are transmitted to the flooring and walls, an increase in the dust mite count can ensue within the living areas. Dust mites, as well as dampness in general, can be a health hazard to inhabitants, particularly those who are abnormally susceptible to respiratory ailments.

#### The garden

The ideal vegetation layout is to have lawn or plants that require only light watering immediately adjacent to the drainage or paving edge, then more demanding plants, shrubs and trees spread out in that order.

Overwatering due to misuse of automatic watering systems is a common cause of saturation and water migration under footings. If it is necessary to use these systems, it is important to remove garden beds to a completely safe distance from buildings.

#### Existing trees

Where a tree is causing a problem of soil drying or there is the existence or threat of upheaval of footings, if the offending roots are subsidiary and their removal will not significantly damage the tree, they should be severed and a concrete or metal barrier placed vertically in the soil to prevent future root growth in the direction of the building. If it is not possible to remove the relevant roots without damage to the tree, an application to remove the tree should be made to the local authority. A prudent plan is to transplant likely offenders before they become a problem.

#### Information on trees, plants and shrubs

State departments overseeing agriculture can give information regarding root patterns, volume of water needed and safe distance from buildings of most species. Botanic gardens are also sources of information. For information on plant roots and drains, see Building Technology File 17.

#### Excavation

Excavation around footings must be properly engineered. Soil supporting footings can only be safely excavated at an angle that allows the soil under the footing to remain stable. This angle is called the angle of repose (or friction) and varies significantly between soil types and conditions. Removal of soil within the angle of repose will cause subsidence.

#### Remediation

Where erosion has occurred that has washed away soil adjacent to footings, soil of the same classification should be introduced and compacted to the same density. Where footings have been undermined, augmentation or other specialist work may be required. Remediation of footings and foundations is generally the realm of a specialist consultant.

Where isolated footings rise and fall because of swell/shrink effect, the homeowner may be tempted to alleviate floor bounce by filling the gap that has appeared between the bearer and the pier with blocking. The danger here is that when the next swell segment of the cycle occurs, the extra blocking will push the floor up into an accentuated dome and may also cause local shear failure in the soil. If it is necessary to use blocking, it should be by a pair of fine wedges and monitoring should be carried out fortnightly.

This BTF was prepared by John Lewer FAIB, MIAMA, Partner, Construction Diagnosis.

should extend outwards a minimum of 900 mm (more in highly reactive soil) and should have a minimum fall away from the building of 1:60. The finished paving should be no less than 100 mm below brick vent bases.

It is prudent to relocate drainage pipes away from this paving, if possible, to avoid complications from future leakage. If this is not practical, earthenware pipes should be replaced by PVC and backfilling should be of the same soil type as the surrounding soil and compacted to the same density.

Except in areas where freezing of water is an issue, it is wise to remove taps in the building area and relocate them well away from the building – preferably not uphill from it (see BTF 19).

It may be desirable to install a grated drain at the outside edge of the paving on the uphill side of the building. If subsoil drainage is needed this can be installed under the surface drain.

#### Condensation

In buildings with a subfloor void such as where bearers and joists support flooring, insufficient ventilation creates ideal conditions for condensation, particularly where there is little clearance between the floor and the ground. Condensation adds to the moisture already present in the subfloor and significantly slows the process of drying out. Installation of an adequate subfloor ventilation system, either natural or mechanical, is desirable.

**Warning:** Although this Building Technology File deals with cracking in buildings, it should be said that subfloor moisture can result in the development of other problems, notably:

The information in this and other issues in the series was derived from various sources and was believed to be correct when published.

The information is advisory. It is provided in good faith and not claimed to be an exhaustive treatment of the relevant subject.

Further professional advice needs to be obtained before taking any action based on the information provided.

Distributed by

CSIRO PUBLISHING PO Box 1139, Collingwood 3066, Australia

Freecall 1800 645 051 Tel (03) 9662 7666 Fax (03) 9662 7555 www.publish.csiro.au

Email: publishing.sales@csiro.au

© CSIRO 2003. Unauthorised copying of this Building Technology file is prohibited